Appendix A

2011 Total Dissolved Gas

Fixed Monitoring Stations

Updated February 2012

This page is purposely left blank for duplex

Introduction

The Corps fixed monitoring station (FMS) system is composed of 28 gages that collect hourly readings of total dissolved gas, barometric pressure, % TDG saturation and water temperature. This data is associated with 19 projects on the Columbia and Lower Snake Rivers and they are listed on Table 1 which provides general information on the projects. These projects are involved or affected by the total dissolved gas issues in some way. More detailed information about the FMS is found in Tables 2 and the section afterwards. Figure 1 provides a map of the FMS locations.

Table 1: Project Information

Project Name	Project Code	River Name	River Mile	Number of Spill Bays	Location of Spill Bays	Number of Power Houses	Number of Generating Units	Hydraulic Capacity, kcfs	Generation Capacity, MW
Albeni Falls	ALF	Pend Oreille	86.9	10	Left Bank	1	3	33	49
Bonneville	BON	Columbia River	146.1	0	Mid-River	2	18	288	1207
Chief Joseph	CHJ	Columbia River	545.1	0	Right Bank	1	27	219	2614
Dworshak	DWR	North Fork, Clearwater River	1.9	2	Left Bank	1	3	10.5	460
Grand Coulee	GCL	Columbia River	596.6	11	Mid-River	3	24	280	7416
Hungry Horse	HGH	Flathead River, South Fork	5.2	0	Right Bank	1	4	8.9	328
Ice Harbor	IHR	Snake River	9.7	10	Right Bank	1	6	106	693
John Day	JDA	Columbia River	215.6	20	Right Bank	1	16	322	2485
Libby	LIB	Kootenai River	221.9	2	Mid-River	1	5	24	604
Little Goose	LGS	Snake River	70.3	8	Mid-River	1	6	130	932
Lower Granite	LWG	Snake River	107.5	8	Mid-River	1	6	130	932
Lower Monumental	LMN	Snake River	41.6	8	Left Bank	1	6	130	932
McNary	MCN	Columbia River	292	22	Right Bank	1	14	232	1127
Priest Rapids	PRD	Columbia River	397.1	22	Right Bank	1	10	187	907
Rock Island	RIS	Columbia River	453.4	31	Mid-River	2	18	220	613
Rocky Reach	RRH	Columbia River	473.7	12	Left Bank	2	11	220	1212
The Dalles	TDA	Columbia River	191.5	23	Mid-River	1	22	375	2052
Wanapum	WAN	Columbia River	415.8	13	Right Bank	1	10	178	956
Wells	WEL	Columbia River	515.1	10	Mid-River	1	10	220	890

Table 2: Total Dissolved Gas (TDG) Monitoring Station Summary Data Sheet

Station Name	Station Code	Years of Operation	Dates of Operation	River Name	River Mile	Bank	Latitude[1]	Longitude[1]	Project	Location Description	Maintanence Responsibility	Maintenance Sequence	Calibration Responsibility	Owner
Albeni Falls Forebay	ALFI	2004-Present	April 1-Sept 15	Pend Oreille River	87.0	Right Bank	48° 10' 40.2"	116° 59' 52.3"	Albani Falls Dam	Forebay	Columbia Basin Environmental	Bi-weekly	Columbia Basin Environmental	US Army Corps of Engineers, Seattle District
Albeni Falls Tailwater	ALQI	2005-Present	April 1-Sept 15	Pend Oreille River	86.8	Left Bank	48° 10' 40.1"	117° 00' 8.7"	Albeny Falls Dam	Tailwater	Columbia Basin Environmental	Bi-weekly	Columbia Basin Environmental	US Army Corps of Engineers, Seattle District
Anatone	ANQW	1999-Present	April 1-Sept 15	Snake River	167.5	Left Bank	46° 05' 50.8"	116° 58' 41.2"	None	River	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Bonneville Forebay	BON	1986-Present	April 1-Sept 15	Columbia River	146.1	Right Bank	45° 38' 44.4"	121° 56' 24.3"	Bonneville Dam	Forebay	US Geological Survey, Portland Office	Bi-weekly	US Geological Survey, Portland Office	US Army Corps of Engineers, Portland District
Camas-Washougal	CWMW	1993-Present	April 1-Sept 15	Columbia River	121.7	Right Bank	45° 34' 38.4"	122° 22' 43.3"	None	River	US Geological Survey, Portland Office	Bi-weekly	US Geological Survey, Portland Office	US Army Corps of Engineers, Portland District
Cascades Island	CCIW	2004-Present	April 1-Sept 15	Columbia River	145.9	Right Bank	45° 38' 44.4"	121° 56' 44.3"	Bonneville Dam	Tailwater	US Geological Survey, Portland Office	Bi-weekly	US Geological Survey, Portland Office	US Army Corps of Engineers, Portland District
Chief Joseph Forebay	CHJ	1985-Present	April 1-Sept 15	Columbia River	545.1	Left Bank	47° 59' 38.7"	119° 38' 42.6"	Chief Joseph Dam	Forebay	Columbia Basin Environmental	Bi-weekly	Columbia Basin Environmental	US Army Corps of Engineers, Seattle District
Chief Joseph Tailwater	CHQW	1985-Present	April 1-Sept 15	Columbia River	543.8	Right Bank	48° 00' 17.2"	117° 39' 30.3"	Chief Joseph Dam	Tailwater	Columbia Basin Environmental	Bi-weekly	Columbia Basin Environmental	US Army Corps of Engineers, Seattle District
Dworshak Tailwater	DWQI	1993-Present	Year Round	North Fork, Clearwater River	0.5	Left Bank	46° 30' 11.6"	116° 19' 16.4"	Dworshak Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Ice Harbor Forebay	IHRA	2005-Present	April 1-Sept 15	Snake River	10.2	Right Bank	46° 15' 5.8"	118° 52' 39.0"	Ice Harbor Dam	Forebay	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Ice Harbor Tailwater	IDSW	1994-Present	Year Round	Snake River	6.1	Right Bank	46° 14' 27.6"	118° 57' 13.7"	Ice Harbor Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
John Day Forebay	JDY	2004-Present	April 1 - Sept 15	Columbia River	215.7	Right Bank	45° 43' 13.4"	120° 41' 41.2"	John Day Dam	Forebay	US Geological Survey, Portland Office	Bi-weekly	US Geological Survey, Portland Office	US Army Corps of Engineers, Portland District
John Day Tailwater	JHAW	1995-Present	Year Round	Columbia River	214.8	Right Bank	45° 42' 48.4"	120° 42' 39.2"	John Day Dam	Forebay	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Lewiston	LEWI	1996-Present	April 1-Sept 15	Columbia River	5.0	Right Bank	46° 25' 52.1"	116° 56' 44.0"	None	River	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District

Table 2: con't Total Dissolved Gas (TDG) Monitoring Station Summary Data Sheet

Station Name	Station Code	Years of Operation	Dates of Operation	River Name	River Mile	Bank	Latitude[1]	Longitude[1]	Project	Location Desciption	Maintanence Responsibility	Maintenance Sequence	Calibration Responsibility	Owner
Libby Tailwater	LBQM	2004-Present	April 1 - Sept 15	Kootenai River	221.5	Left Bank	48° 24' 2.4"	115° 19' 7.0"	Libby Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Little Goose Forebay	LGSA	2005-Present	April 1 - Sept 15	Snake River	70.4	Left Bank	46° 34' 58.8"	118° 01' 29.2"	Little Goose Dam	Forebay	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Little Goose Tailwater	LGSW	1995-Present	Year Round	Snake River	69.6	Right Bank	46° 35' 00.5"	118° 02' 37.4"	Little Goose Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Lower Granite Forebay	LWG	1985-Present	April 1 - Sept 15	Snake River	107.5	Mid-River	46° 39' 34.2"	117° 25' 34.9"	Lower Granite Dam	Forebay	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Lower Granite Tailwater	LGNW	1995-Present	Year Round	Snake River	106.7	Right Bank	46° 39' 58.1"	117° 26' 19.3"	Lower Granite Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Lower Monumental Forebay	LMNA	2005-Present	April 1 - Sept 15	Snake River	41.7	Mid-River	46° 33' 45.2"	118° 32' 4.4"	Lower Monumental Dam	Forebay	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Lower Monumental Tailwater	LMNW	1995-Present	Year Round	Snake River	40.4	Left Bank	46° 33' 4.5"	118° 32' 59.0"	Lower Monumental Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
McNary Forebay	MCNA	2005-Present	April 1 - Sept 15	Columbia River	292.3	Right Bank	45° 56' 28.8"	119° 17' 35.5"	McNary Dam	Forebay	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
McNary Tailwater	MCPW	1995-Present	Year Round	Columbia River	290.7	Right Bank	45° 56' 2.8"	119° 19' 35.5"	McNary Dam	Tailwater	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Pasco	PAQW	1999-Present	April 1 - Sept 15	Columbia River	329.1	Left Bank	46° 13' 26.3"	119° 06' 57.3"	McNary Dam	River	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
Peck	PEKI	1996-Present	April 1 - Sept 15	Clearwater River	37.4	Left Bank	46° 30' 0.9"	116° 23' 32.4"	Dworshak Dam	River	US Geological Survey, Pasco Office	Bi-weekly	US Geological Survey, Pasco Office	US Army Corps of Engineers, Walla Walla District
The Dalles Forebay	TDA	1985-Present	April 1 - Sept 31	Columbia River	192.4	Left Bank	45° 37' 11.5"	121° 07' 16.5"	The Dalles	Forebay	US Geological Survey	Bi-weekly	US Geological Survey	US Army Corps of Engineers, Portland District
The Dalles Tailwater	TDDO	1996-Present	Year Round	Columbia River	189.1	Left Bank	45° 36' 29.7"	121° 11' 23.8"	The Dalles	Tailwater	US Geological Survey	Bi-weekly	US Geological Survey	US Army Corps of Engineers, Portland District
Warrendale	WRNO	1985-Present	Sept 31 - March 31	Columbia River	140.3	Left Bank	45° 36' 29.1"	122° 02' 19.4"	Bonneville Dam	Tailwater	US Geological Survey	Bi-weekly	US Geological Survey	US Army Corps of Engineers, Portland District

Figure 1
2011 Total Dissolved Gas Fixed Monitoring Stations System

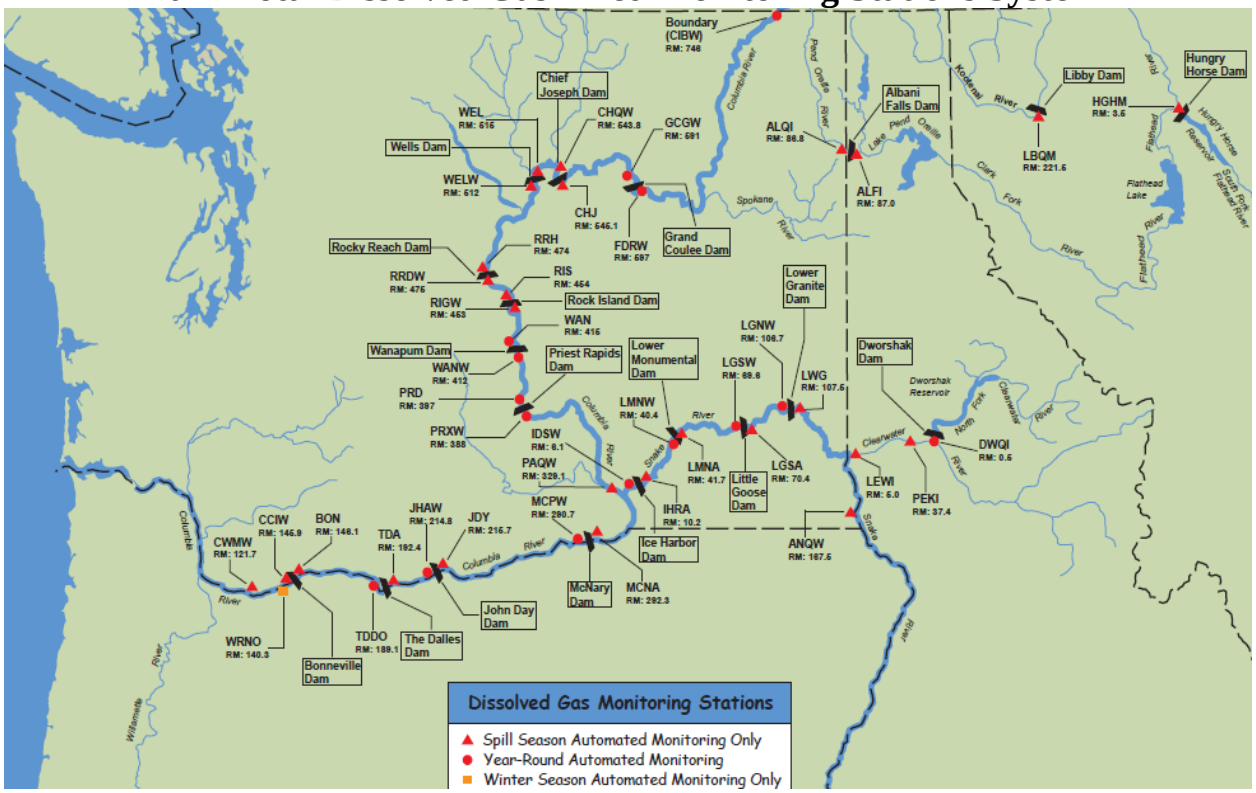

1. Albeni Falls Forebay TDG Monitoring Station (ALFI)

Gage Elevation: Fixed
Latitude: 48° 10' 40.2" N
Longitude: 116° 59' 52.3" W
Distance from Dam: --
Datum: NAD-83
River: Pend Orielle
River Mile: 87.0
USGS-ID: --
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: Radio Transmission
Dates of Operation: April 1– September 15
Years of Operation: 2004 – Present
Water Conditions: Mixed
Location: Attached to the railroad bridge pier on the southern shore of Lake Pend Orielle.
This gage replaced: N/A
Reasons for replacement: N/A
Comments: --

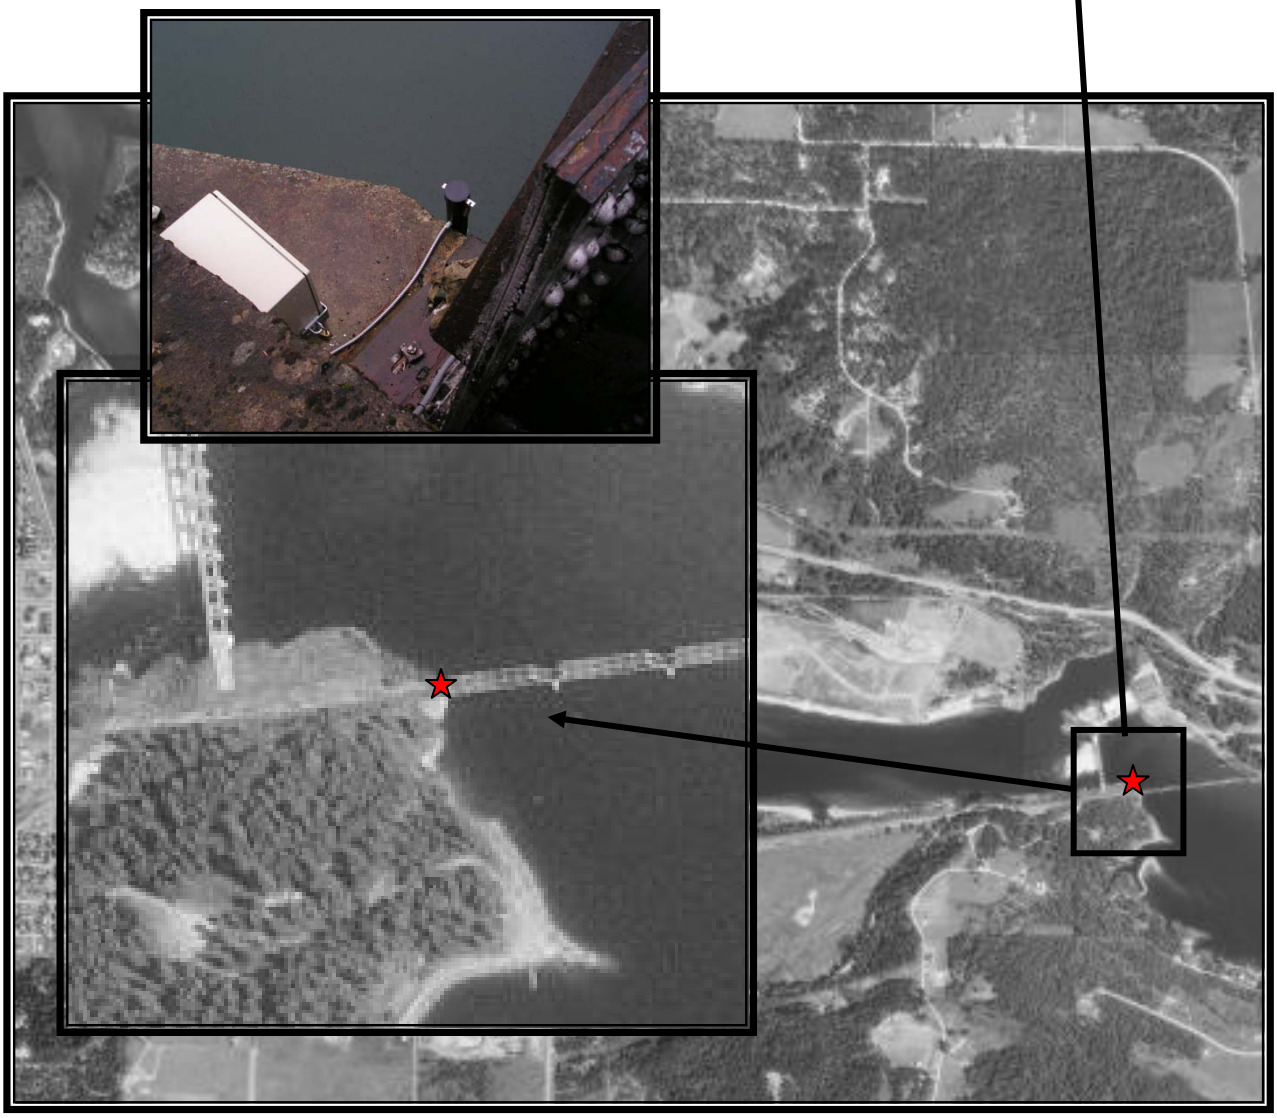

2. Albeni Falls Tailwater TDG Monitoring Station (ALQI)

Gage Elevation: Fixed
Latitude: 48° 10' 40.1" N
Longitude: 117° 00' 8.7" W
Distance from Dam: 700 ft
Datum: NAD-83
River: Pend Orielle
River Mile: 86.8
USGS-ID: --
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: Radio Transmission
Dates of Operation: April 1 – 15 September
Years of Operation: 2005 - Present
Water Conditions: Tailwater Monitor
Location: On the southern shoreline of the Pend Orielle River.
This gage replaced: ALFW
Reasons for replacement: This gauge was initiated at this site on July 28, 2005 due to sediment burying the previous site several times. This newer location is immediately below the spillway aerated zone in deeper water which should minimize sedimentation problems.
Comments: --

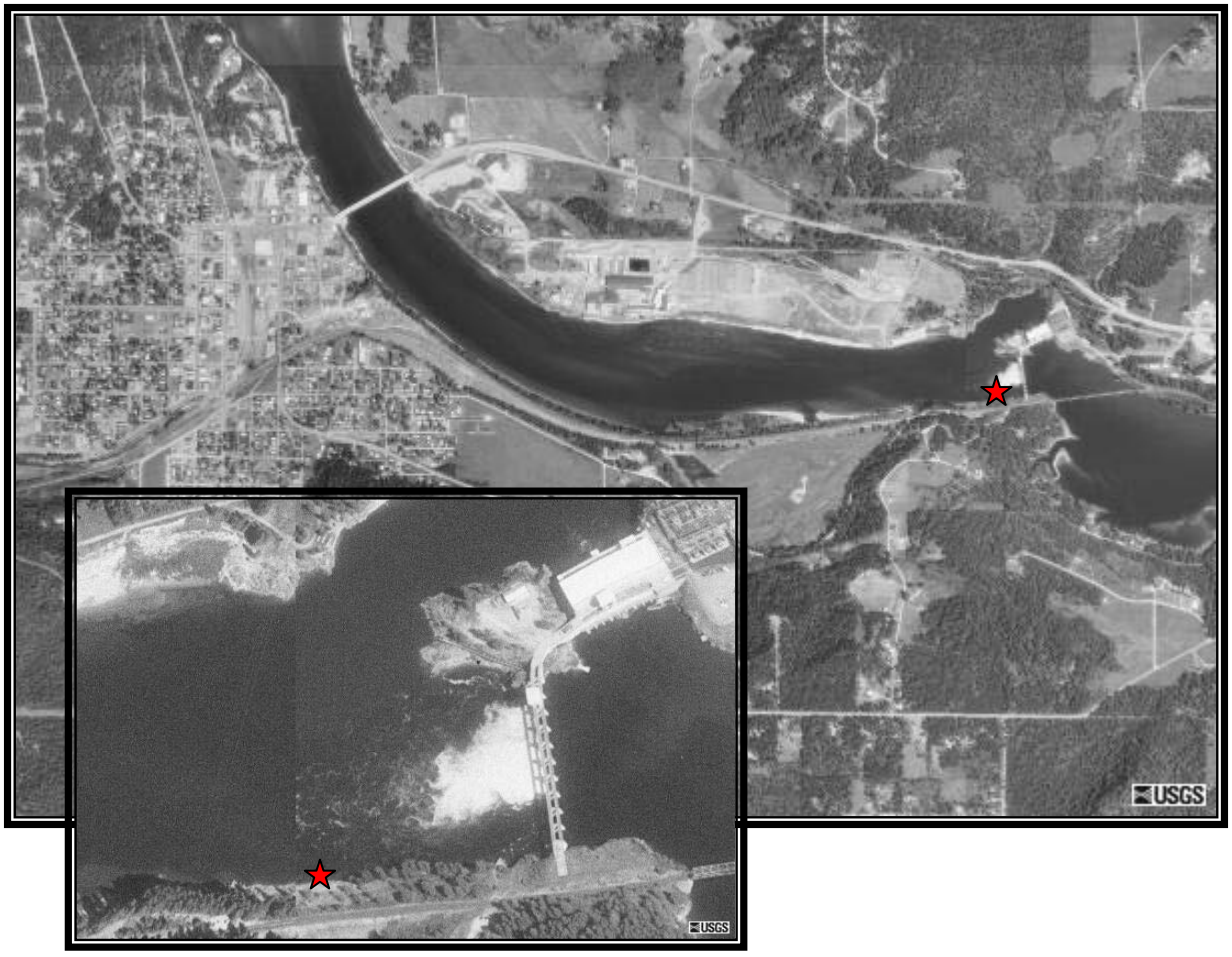

3. Anatone TDG Monitoring Station on the Snake River (ANQW)

Gage Elevation: Fixed
Latitude: 46° 05' 50.8" N
Longitude: 116° 58' 41.2" W
Distance from Dam: --
Datum: NAD-83
River: Snake
River Mile: 167.5
USGS-ID: 13334300
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 1999 - Present
Water Conditions: Open River
Location: This gauge is located on the Washington shoreline of the Snake River approximately 1.3 miles downstream of the Grande Ronde River confluence. It is co-located with the USGS Anatone Stream gauge (ANAW).
This gage replaced: N/A
Reasons for replacement: N/A
Comments: --

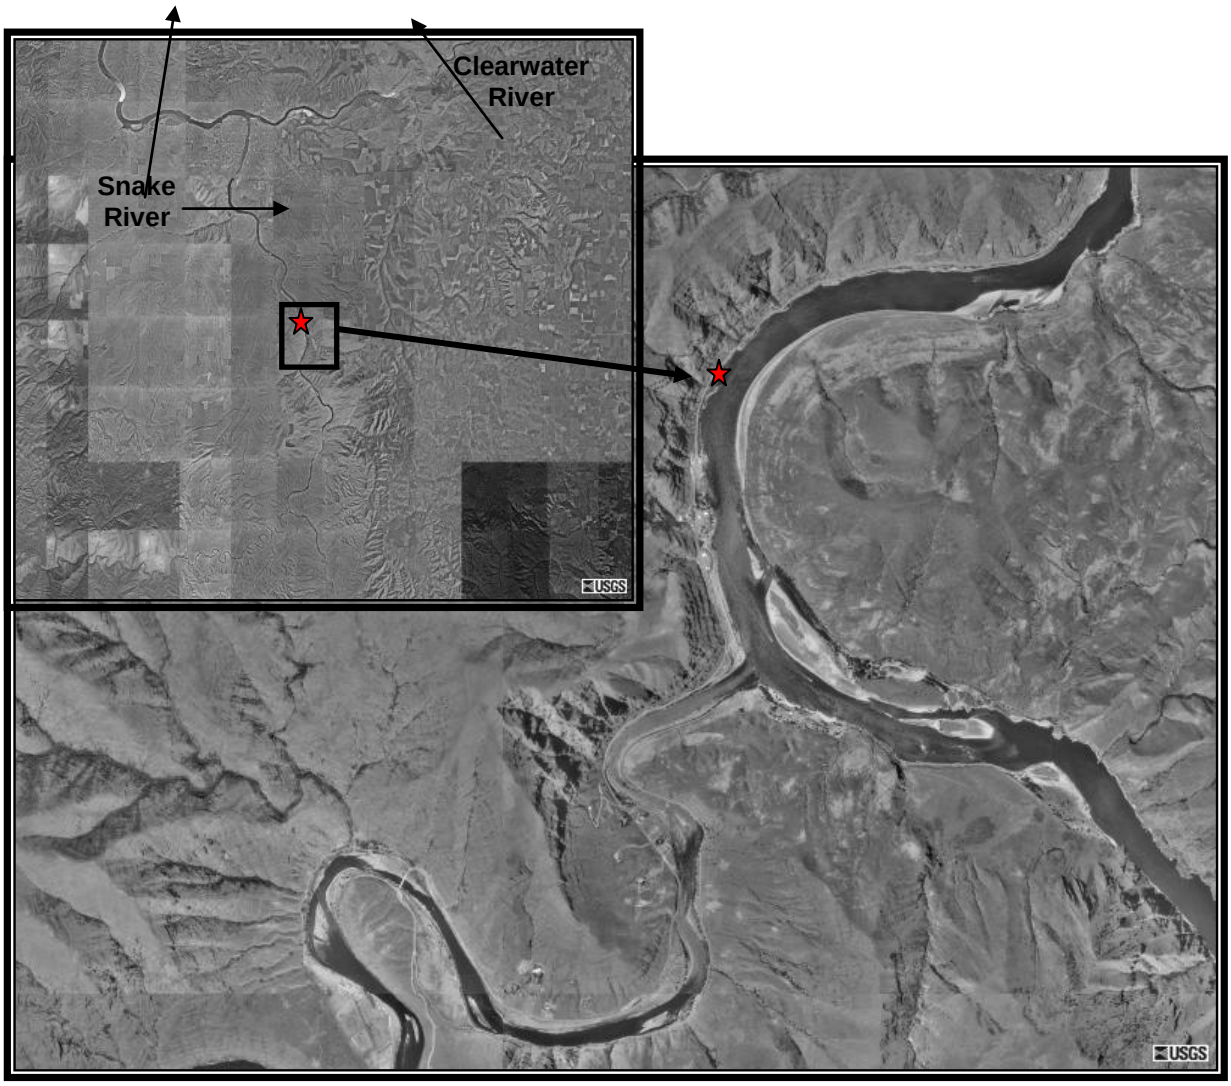

4. Bonneville Forebay TDG Monitoring Station (BON)

Gage Elevation: Fixed
Latitude: 45° 38' 44.4" N
Longitude: 121° 56' 24.3" W
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 146.1
USGS-ID: 453845121562000
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 - Sept 15
Years of Operation: 1986 – Present.
Water Conditions: Mixed
Location: On the northern side of the spillway channel on Cascade Island just upstream of spillbay #1.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

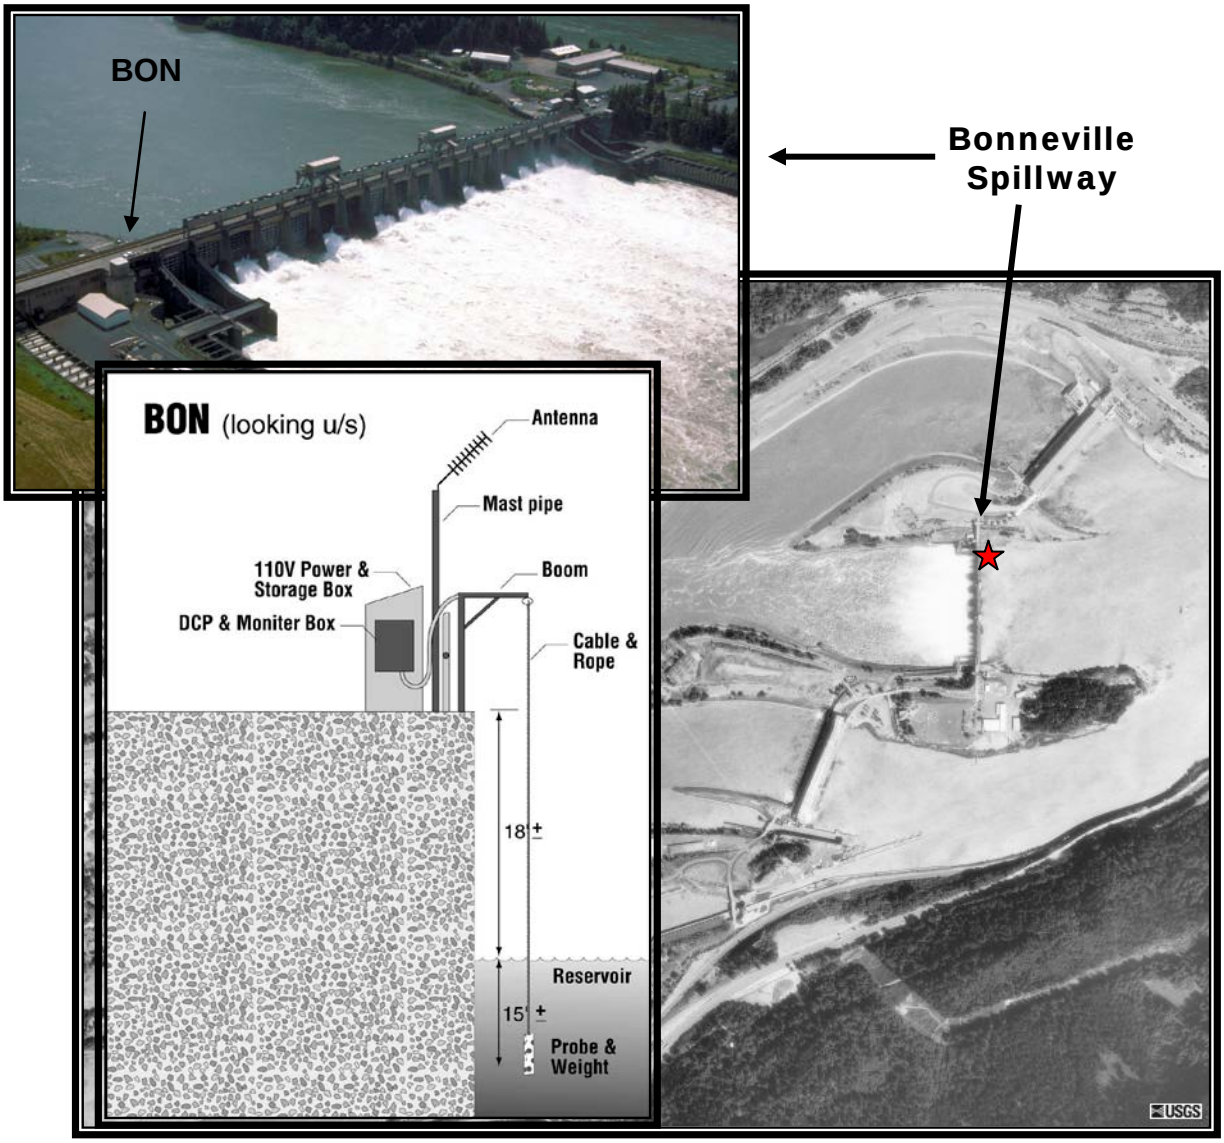

5. Camas-Washougal TDG Monitoring Station (CWMW)

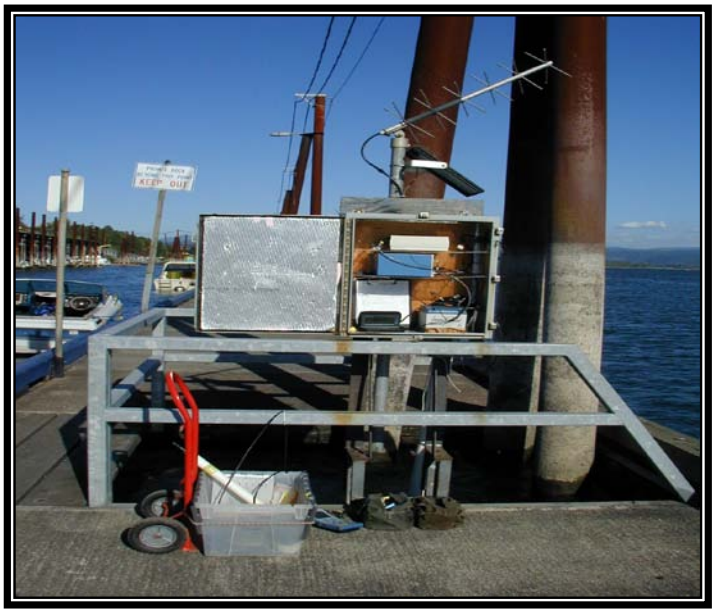

Gage Elevation: Variable
Latitude: 45° 34' 38.4" N
Longitude: 122° 22' 43.3" W
Distance from Dam: 24 miles downstream from Bonneville
Datum: NAD-83
River: Columbia
River Mile: 121.7
USGS-ID: 453439122223900
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept 15
Years of Operation: 1993 – Present
Water Conditions: Mixed
Location: attached to the boat dock at the outer edge of the harbor at the Port of Camas/Washougal, WA
This gage replaced: N/A
Reason for replacement: N/A
Comments: This gauge is currently being utilized as a surrogate forebay gauge for the management of spill at Bonneville Dam.

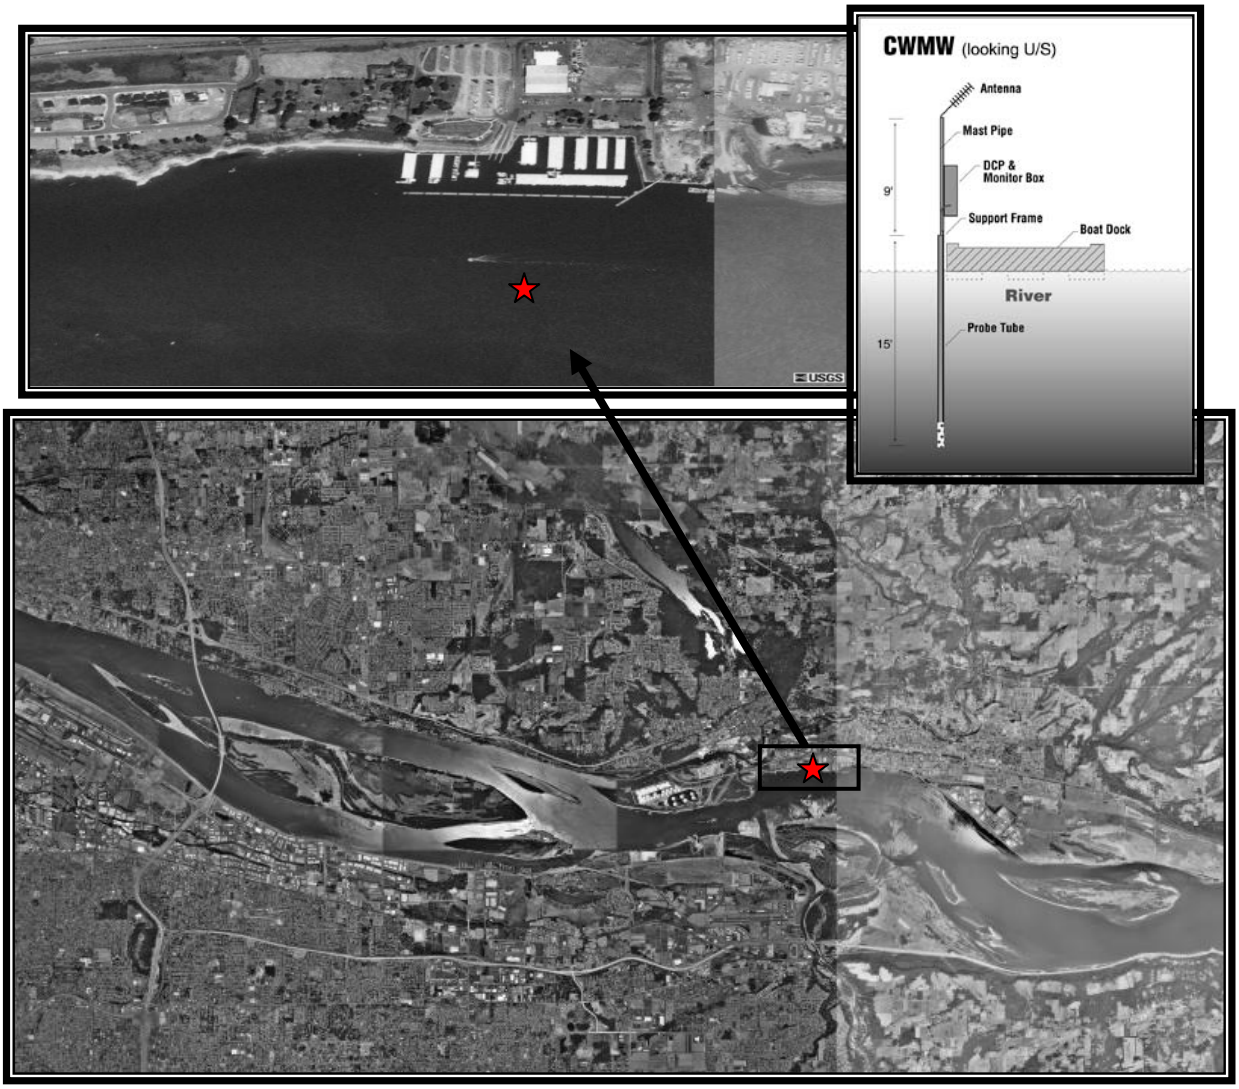

6. Cascades Island TDG Monitoring Station (CCIW)

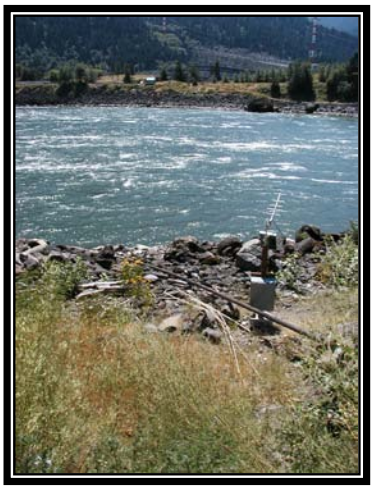

Gage Elevation: Fixed
Latitude: 45° 38' 44.4" N
Longitude: 121° 56' 44.3" W
Distance from Dam: 0.27 miles (1400 ft)
Datum: NAD-83
River: Columbia
River Mile: 145.9
USGS-ID: 453845121564001
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 2004 – Present
Water Conditions: spillway
Location: Within the Bonneville Dam spillway channel on Cascade Island
This gage replaced: N/A
Reason for replacement: N/A
Comments: Became the spill management gage as of 2004.

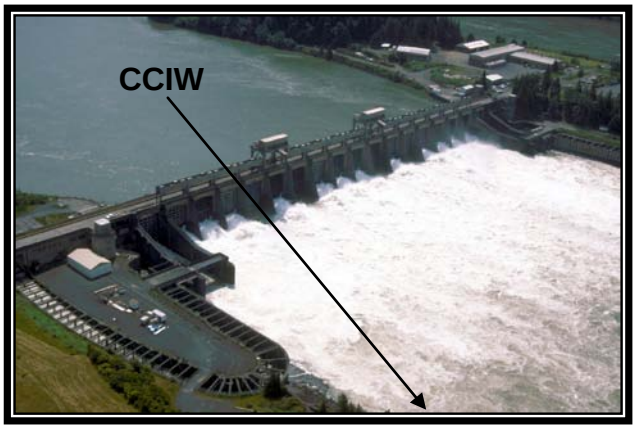

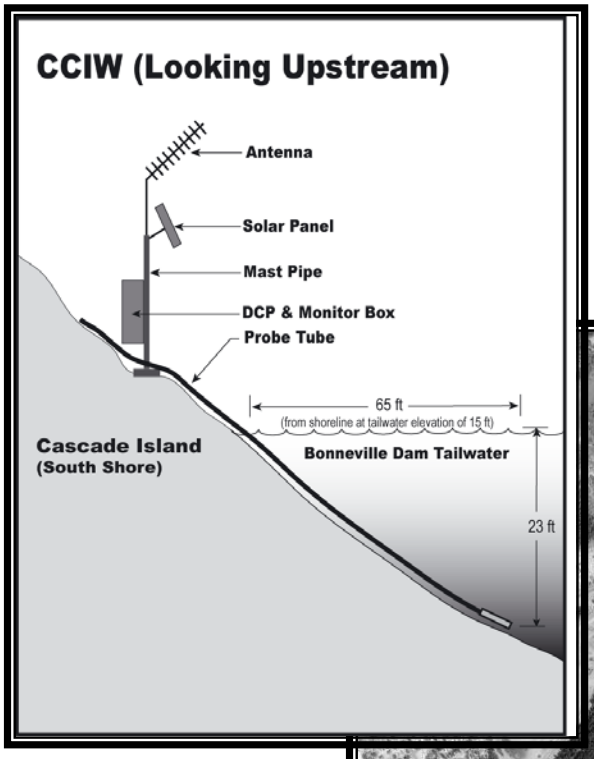

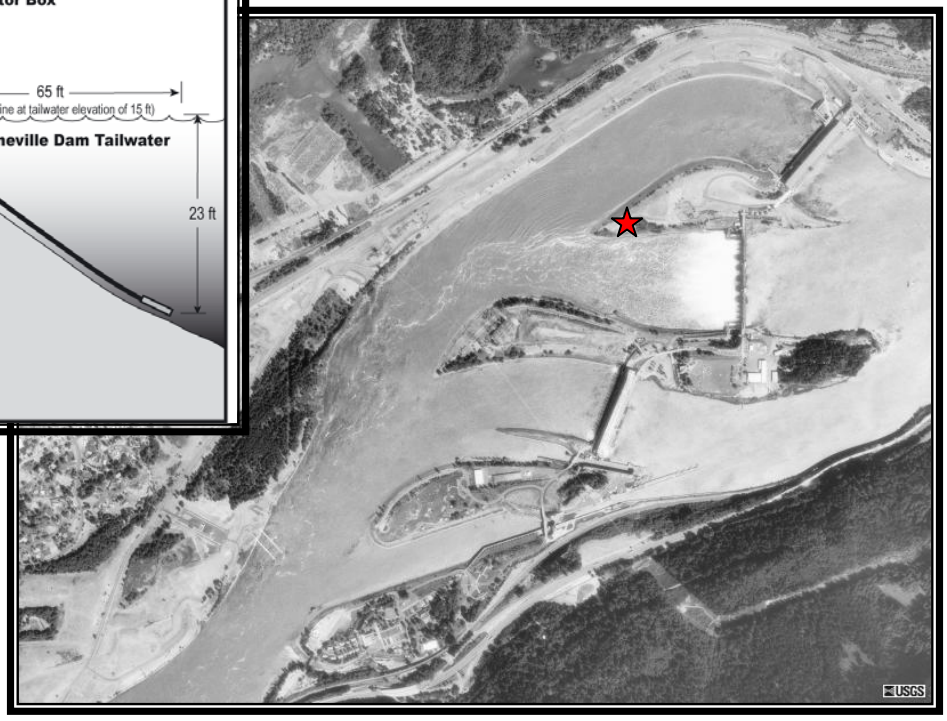

7. Chief Joseph Forebay TDG Monitoring Station (CHJ)

Gage Elevation: Fixed
Latitude: 47° 59' 38.7" N
Longitude: 119° 38' 42.6" W
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 545.1
USGS-ID:
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 1985 - Present
Water Conditions: Mixed
Location: Along the southern edge of Lake Rufus Woods inside the boat house.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

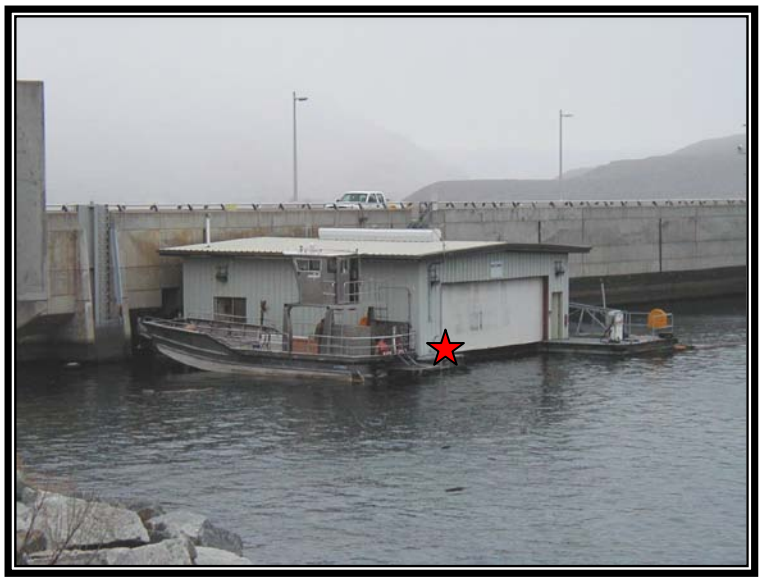

8. <u>Chief Joseph Tailwater TDG Monitoring Station (CHQW)</u>

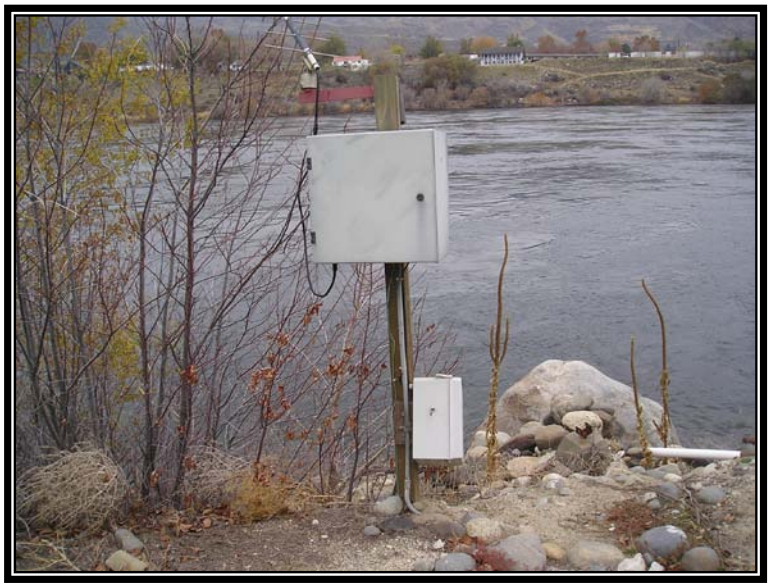

Gage Elevation: Fixed
Latitude: 48° 00' 17.2" N
Longitude: 117° 39' 30.3" W
Distance from Dam: 1 mile
Datum: NAD-83
River: Columbia
River Mile: 543.8
USGS-ID: --
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 1985 - Present
Water Conditions: Spillway
Location: North bank of the river, just downstream of the Highway 17 bridge.
This gage replaced: N/A
Reason for gage replacement: N/A
Comments: --

9. Dworshak TDG Monitoring Station (DWQI)

Gage Elevation: Fixed
Latitude: 46° 30' 11.6" N
Longitude: 116° 19' 16.4" W
Distance from Dam: 1.5 miles
Datum: NAD-83
River: North Fork, Clearwater River
River Mile: 0.5
USGS-ID: --
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Year round
Years of Operation: 1993 - Present
Water Conditions: Mixed
Location: On the southern bank of the North Fork, Clearwater River between the bridge and the U.S. Fish and Wildlife Service Fish Hatchery outflow pipe.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

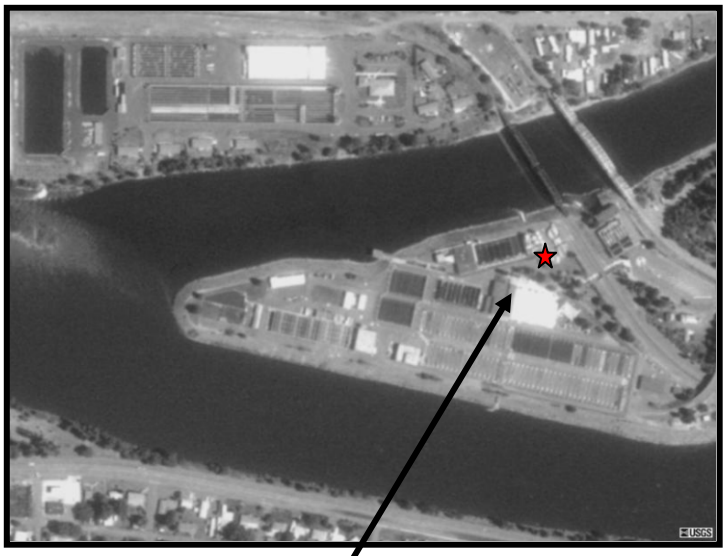

Ice Harbor Forebay TDG Monitoring Station (IHRA)

Gage Elevation: Fixed
Latitude: 46° 15' 5.8" N
Longitude: 118° 52' 39.0" W
Distance from Dam: --
Datum: NAD-83
River: Snake
River Mile: 10.2
USGS-ID: 13352950
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was year round prior to 2006, now seasonal.
Years of Operation: 2005 – Present.
Water Conditions: Mixed
Location: At the upstream end of the navigation lock guidewall
This gage replaced: IHR
Reason for replacement: Moved due to thermal influences and lowered from 15 ft to 45 ft.
Comments: --

Ice Harbor Tailwater TDG Monitoring Station (IDSW)

Gage Elevation: Fixed
Latitude: 46° 14' 27.6" N
Longitude: 118° 57' 13.7" W
Distance from Dam: 3.6 miles
Datum: NAD-83
River: Snake
River Mile: 6.1
USGS-ID: 13353010
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was seasonal prior to 2006, now year round.
Years of Operation: 1994 – Present.
Water Conditions: mixed &spillway
Location: On the northern shore of the Snake River
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

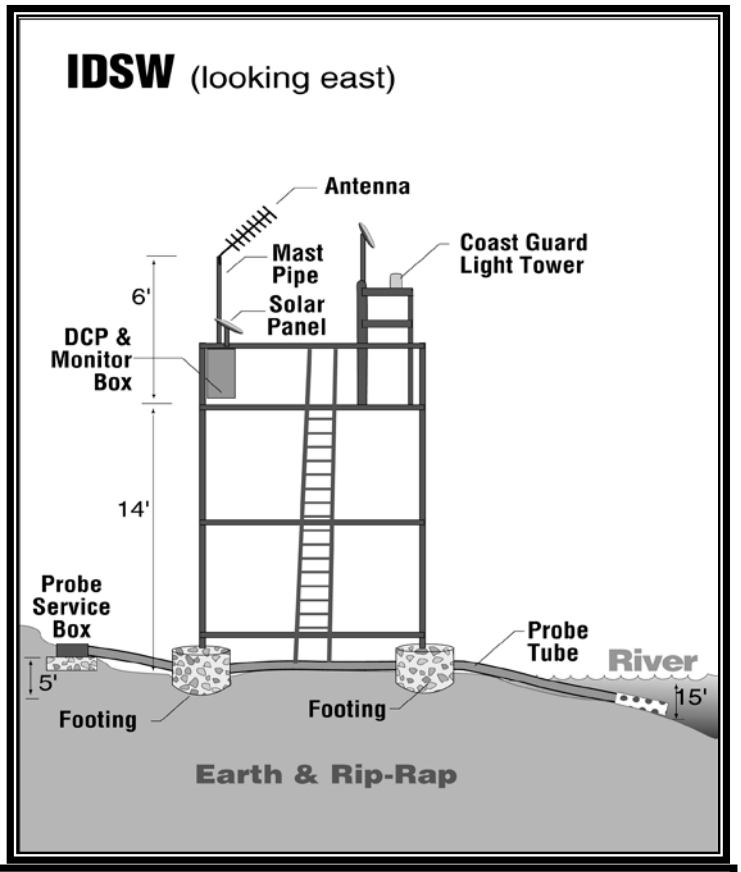

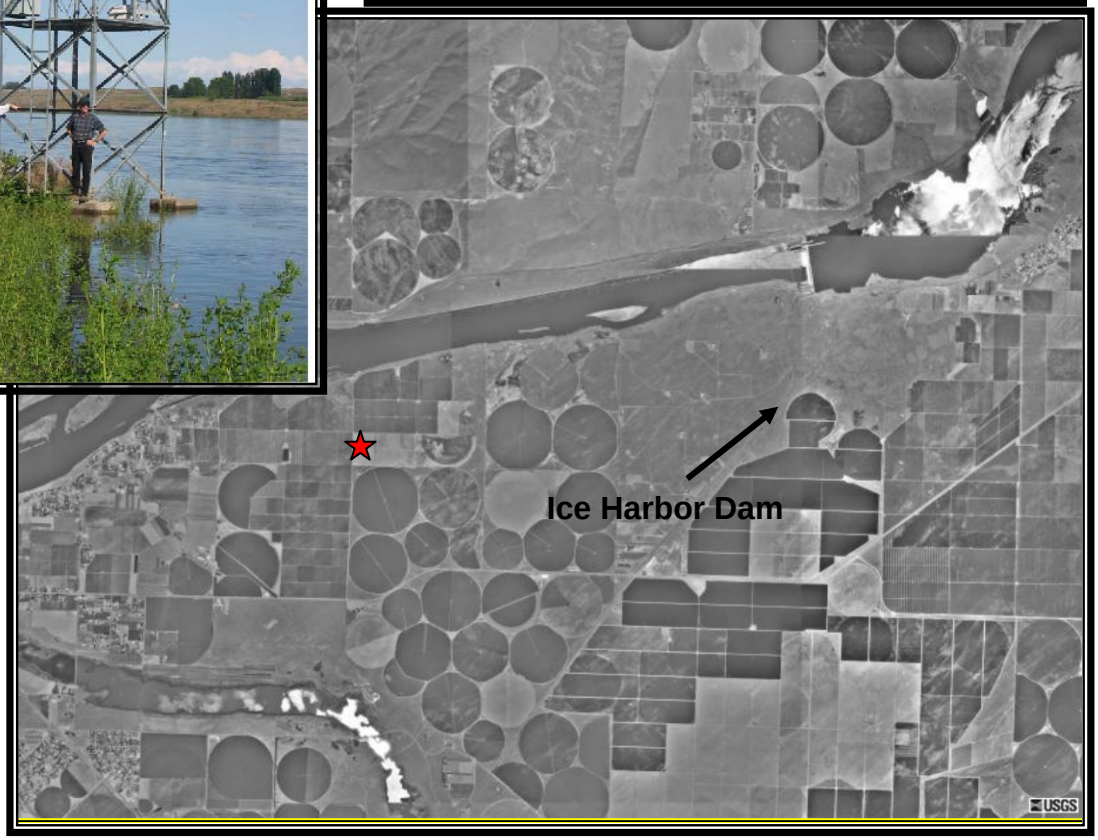

12. John Day Forebay TDG Monitoring Station (JDY)

Gage Elevation: Variable
Latitude: 45° 43' 13.4" N
Longitude: 120° 41' 41.2" W
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 215.7
USGS-ID: 453439122223900
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 2004 – Present
Water Conditions: Mixed
Location: At the end of the navigation lock guidewall
This gage replaced: JDA
Reason for replacement: Moved due to thermal influences and lowered from 15 ft to 45 ft.
Comments: --

13. John Day Tailwater TDG Monitoring Station (JHAW)

Gage Elevation: Fixed
Latitude: 45° 42' 48.4" N
Longitude: 120° 42' 39.2" W
Distance from Dam: 0.8 miles
Datum: NAD-83
River: Columbia
River Mile: 214.8
USGS-ID: 454249120423500
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was seasonal prior to 2006, now year round.
Years of Operation: 1995 – Present
Water Conditions: Spillway
Location: Other Washington shore.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

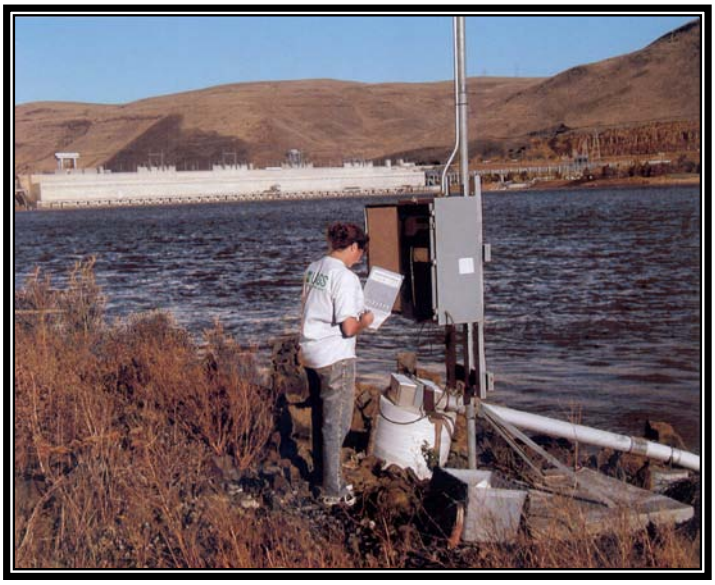

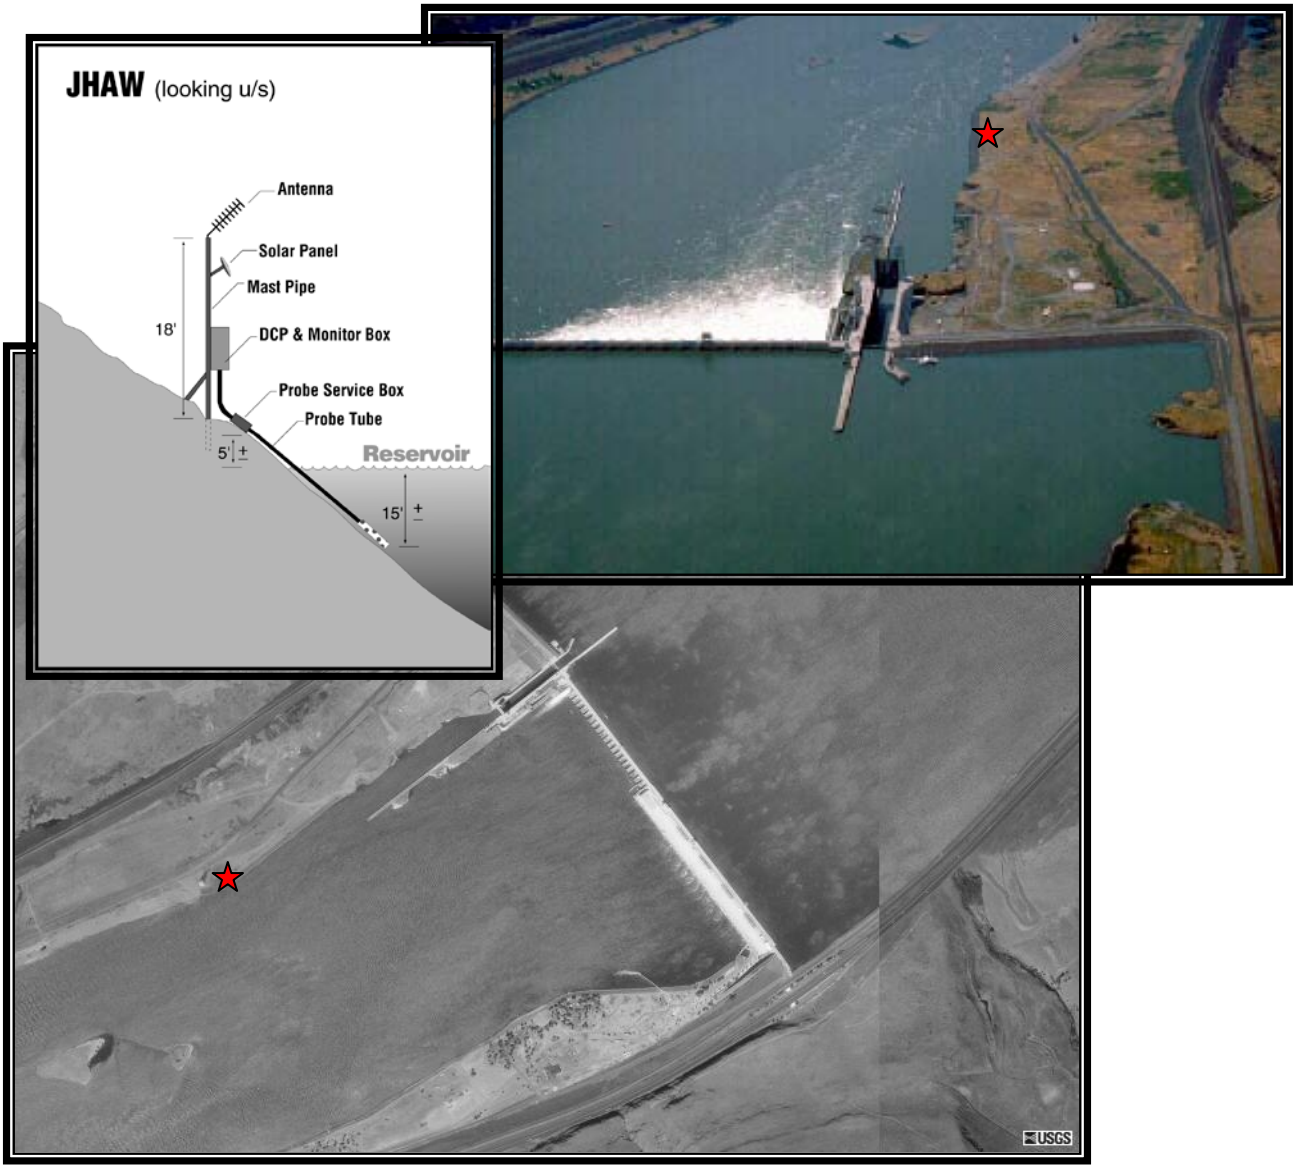

Lewiston TDG Monitoring Station (LEWI)

Gage Elevation: Fixed
Latitude: 46° 25' 52.1"
Longitude: 116° 56' 44.0"
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 5.0
USGS-ID: 13343000
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 1996 - Present
Water Conditions: Open River
Location: On the northern shore of the Clearwater River just east of the City of Lewiston, Idaho near the junction of Hatwai Road and Central Grade Road.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

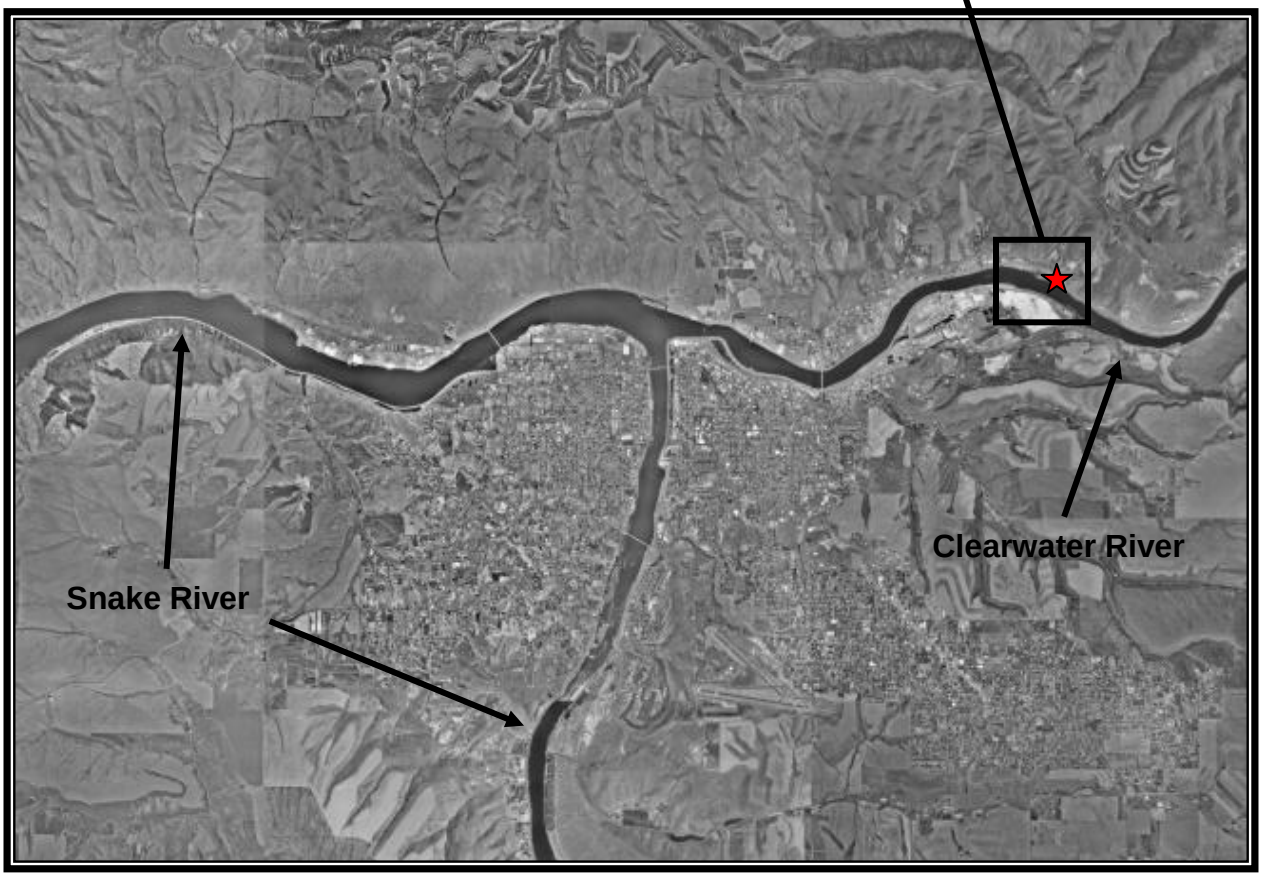

15. Libby Tailwater TDG Monitoring Station (LBQM)

Gage Elevation: Fixed
Latitude: 48° 24' 2.4"
Longitude: 115° 19' 7.0"
Distance from Dam: --
Datum: NAD-83
River: Kootenai
River Mile: 221.5
USGS-ID:
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite and Radio Transmission
Dates of Operation: April 1 – Sept. 15
Years of Operation: 2004 - Present
Water Conditions: Open River
Location: This gauge is located on the eastern shore of the Kootenai River approximately 750 feet downstream of the Libby Dam access road bridge.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

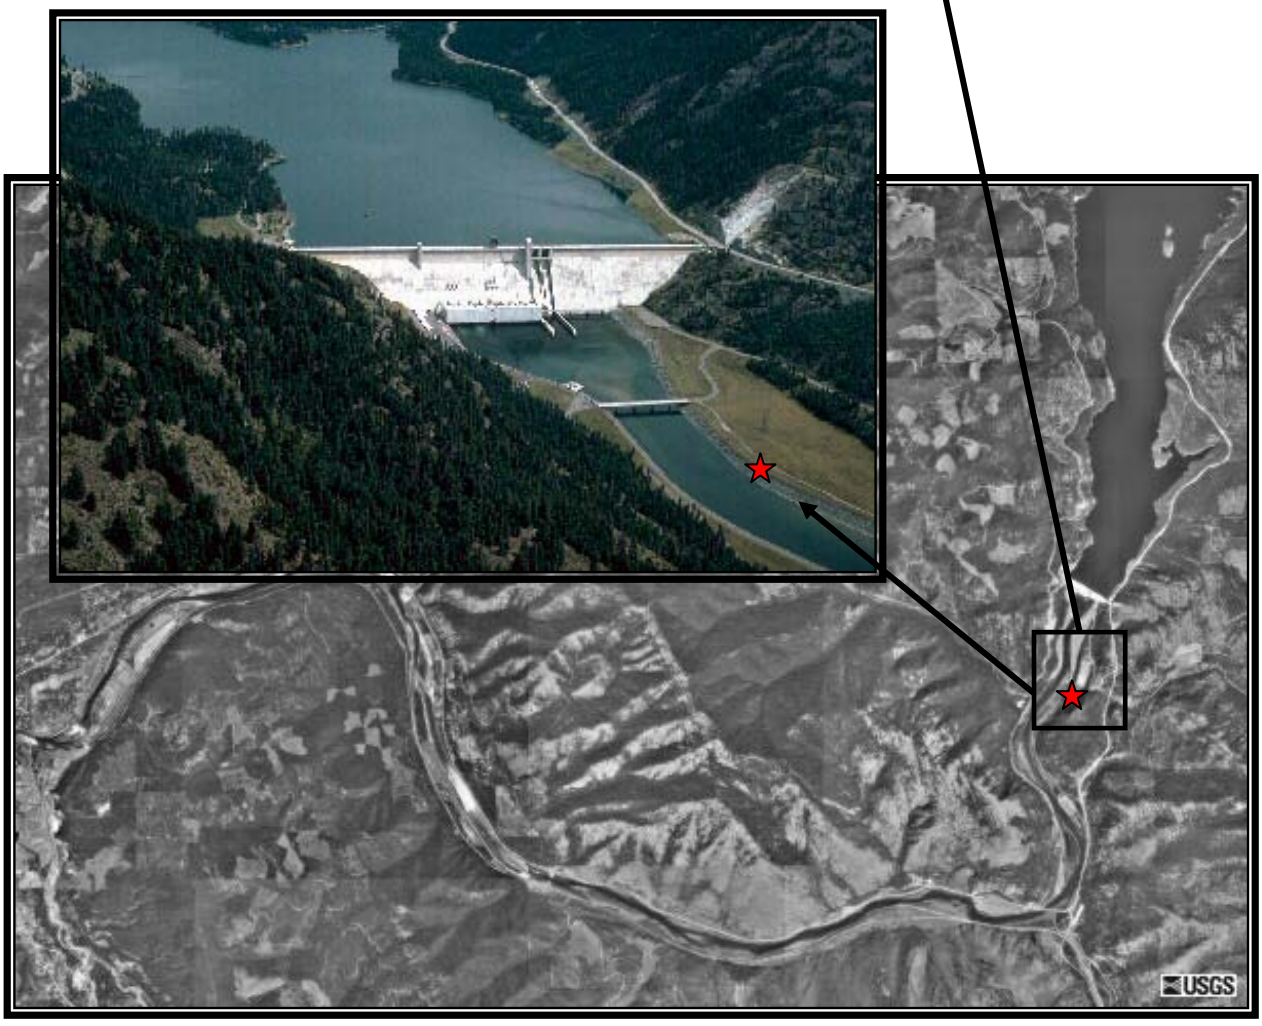

Little Goose Forebay TDG Monitoring Station (LGSA)

Gage Elevation: Variable (15 m depth)
Latitude: 46° 34' 58.8" N
Longitude: 118° 01' 29.2" W
Distance from Dam: --
Datum: NAD-83
River: Snake
River Mile: 70.4
USGS-ID: 13343855
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1-Sept. 15
Years of Operation: 2005 – Present.
Water Conditions: Mixed
Location: At the upstream end of the navigation lock guidewall.
This gage replaced: LGS
Reason for replacement: Move due to thermal influences and lowered from 15 ft to 45 ft.
Comments: --

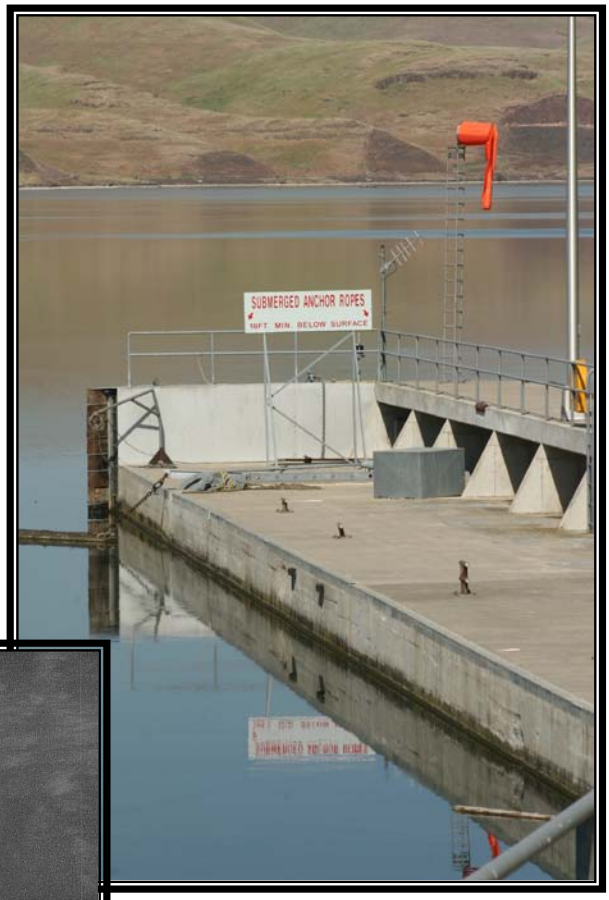

Little Goose Tailwater TDG Monitoring Station (LGSW)

Gage Elevation: Fixed
Latitude: 46° 35' 00.5" N
Longitude: 118° 02' 37.4" W
Distance from Dam: 0.7 miles
Datum: NAD-83
River: Snake
River Mile: 69.6
USGS-ID: 13343860
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was seasonal prior to 2006, now year round.
Years of Operation: 1995 – Present.
Water Conditions: switches between mixed & spillway
Location: On the northern shore of the Snake River
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

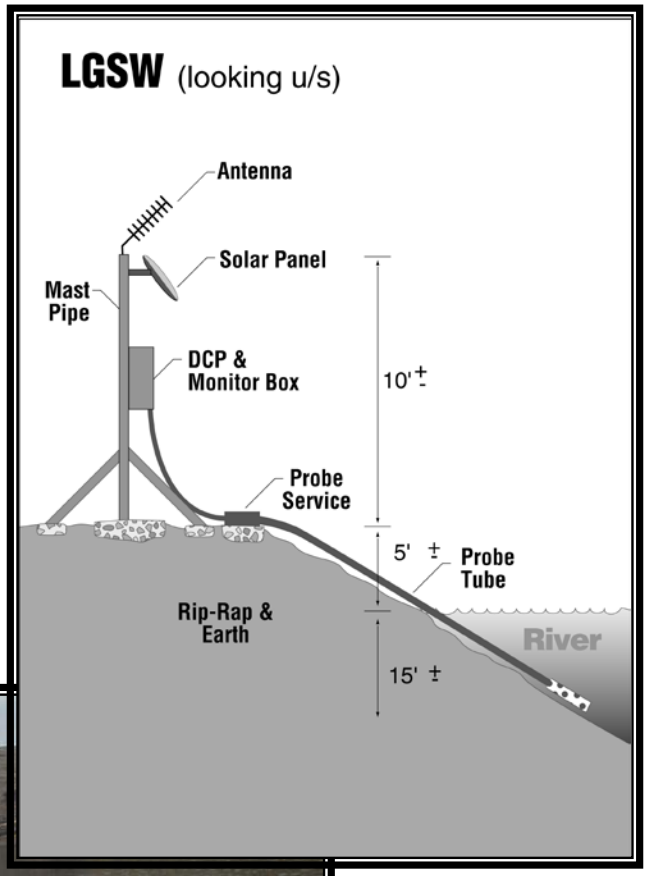

Lower Granite Forebay TDG Monitoring Station (LWG)

Gage Elevation: Fixed
Latitude: 46° 39' 34.2" N
Longitude: 117° 25' 34.9" W
Distance from Dam: --
Datum: NAD-83
River: Snake
River Mile: 107.5
USGS-ID: 13343590
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was year round prior to 2006, now seasonal
Years of Operation: 1985 – Present.
Water Conditions: Mixed
Location: At the upstream end of the navigation lock guidewall.
This gage replaced: N/A
Reason for replacement: In March, 2005, this gauge was moved from a depth of 15 ft to 45 ft to avoid thermal influences. The geographic location of the gauge was not changed.
Comments: --

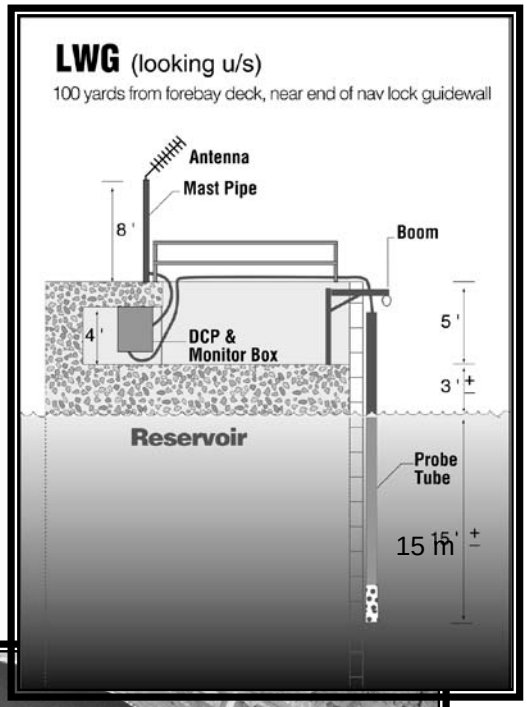

Lower Granite Tailwater TDG Monitoring Station (LGNW)

Gage Elevation: Fixed
Latitude: 46° 39' 58.1" N
Longitude: 117° 26' 19.3" W
Distance from Dam: 0.8 miles
Datum: NAD-83
River: Snake
River Mile: 106.7
USGS-ID: 13343595
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Year around
Years of Operation: 1995 – Present.
Water Conditions: switches between mixed & spillway
Location: On the northeastern shore of the Snake River.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

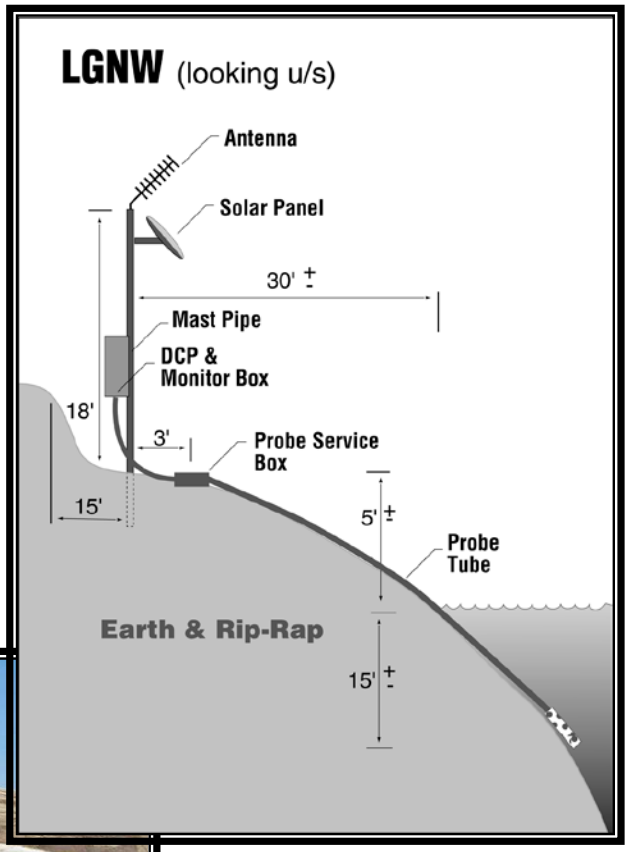

Lower Monumental Forebay TDG Monitoring Station (LMNA)

Gage Elevation: Fixed
Latitude: 46° 33' 45.2" N
Longitude: 118° 32' 4.4" W
Distance from Dam: --
Datum: NAD-83
River: Snake
River Mile: 41.7
USGS-ID: 13352595
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1-Sept. 15.
Years of Operation: 2005 – Present.
Water Conditions: mixed
Location: At the upstream end of the navigation lock guidewall.
This gage replaced: LMN
Reason for replacement: Moved due to thermal influences and lowered from 15 ft to 45 ft.
Comments: Replaced LMN in 2005.

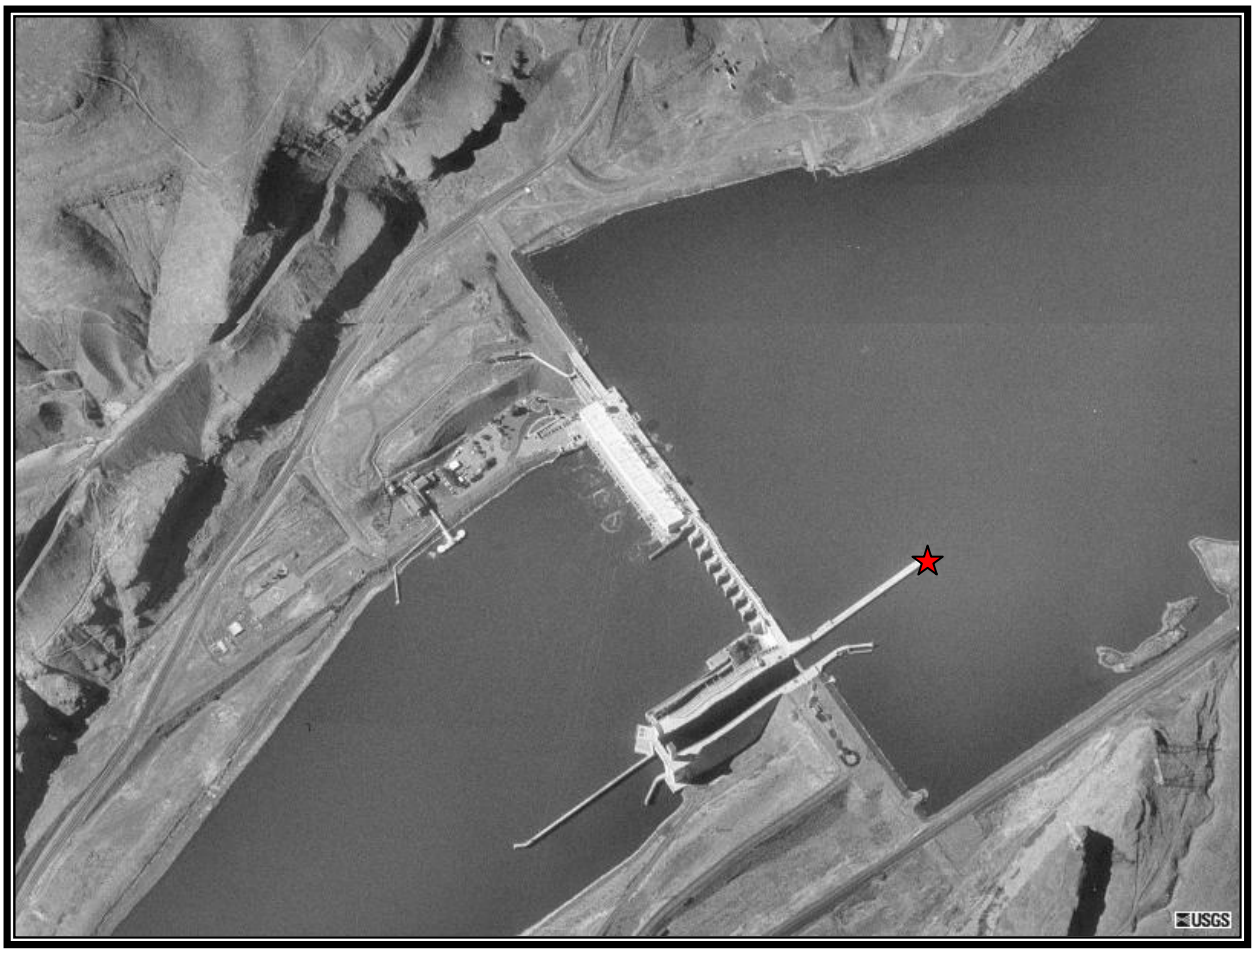

Lower Monumental Tailwater TDG Monitoring Station (LMNW)

Gage Elevation: Fixed
Latitude: 46° 33' 04.5" N
Longitude: 118° 32' 59.0" W
Distance from Dam: 1 mile
Datum: NAD-83
River: Snake
River Mile: 40.4
USGS-ID: 13352600
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was seasonal prior to 2006, now year around.
Years of Operation: 1995 – Present.
Water Conditions: switches between mixed & spillway
Location: On the southeastern shore of the Snake River.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

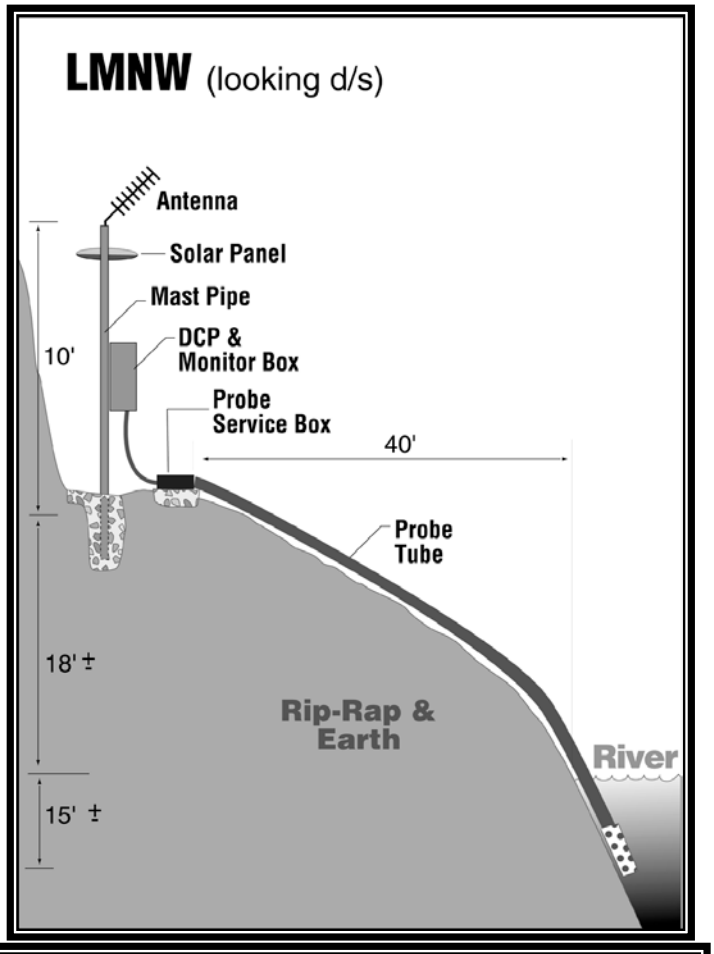

McNary Forebay TDG Monitoring Station (MCNA)

Gage Elevation: Variable
Latitude: 45° 56' 28.8"
Longitude: 119° 17' 35.5"
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 292.3
USGS-ID: 14019220
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 2005 - Present
Water Conditions: Mixed
Location: At the end of the navigation lock guidewall near the Washington shoreline.
This gage replaced: MCQW (Washington side) and MCQO (Oregon side)
Reason for replacement: Moved due to thermal influences and lowered from 15 ft to 45 ft.
Comments: --

McNary Tailwater TDG Monitoring Station (MCPW)

Gage Elevation: Fixed
Latitude: 45° 56' 2.8"
Longitude: 119° 19' 35.5"
Distance from Dam: 1.3 miles
Datum: NAD-83
River: Columbia
River Mile: 290.7
USGS-ID: 14019240
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Year around
Years of Operation: 1995 - Present
Water Conditions: Spillway
Location: On a rocky outcrop on the Washington shore and just upstream of the Highway 395 bridge.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

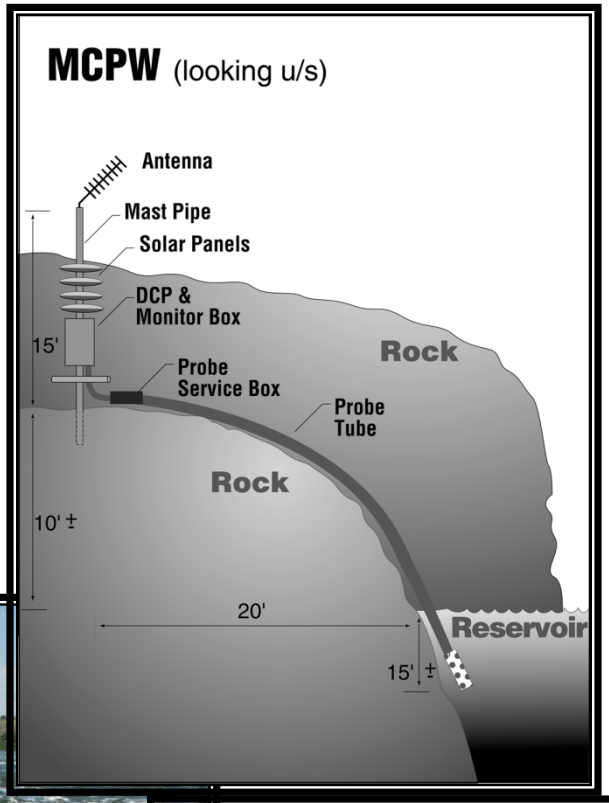

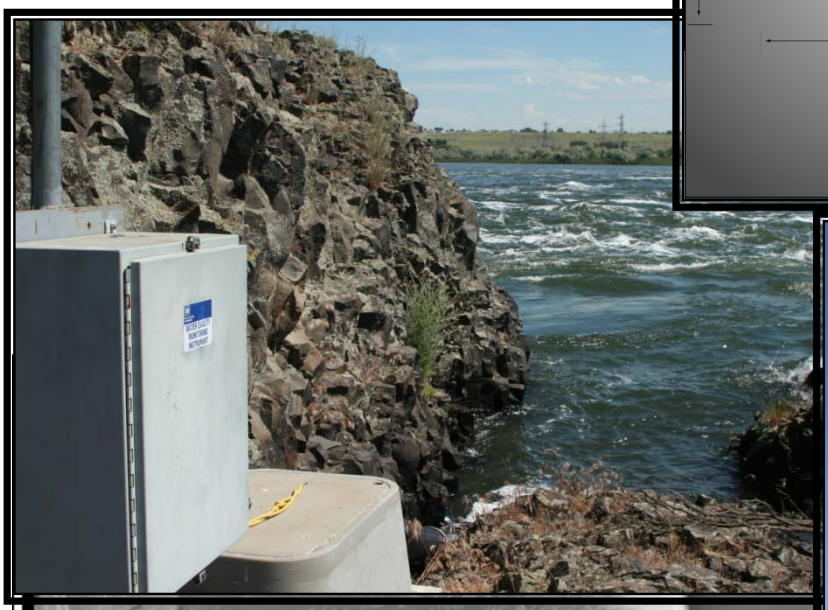

Pasco TDG Monitoring Station (PAQW)

Gage Elevation: Fixed
Latitude: 46° 13' 26.3"
Longitude: 119° 06' 57.3"
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 329.1
USGS-ID: 12514400
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 1999 - Present
Water Conditions: Open River
Location: On the northern shore of the Columbia River between the S. 10th Avenue bridge and the Highway 395 bridge in Pasco, WA. It is on the levee adjacent to a wetland area near the Pasco Youth Baseball Complex. The site is within Lake Wallula approximately 5 miles upstream of the Snake River confluence.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

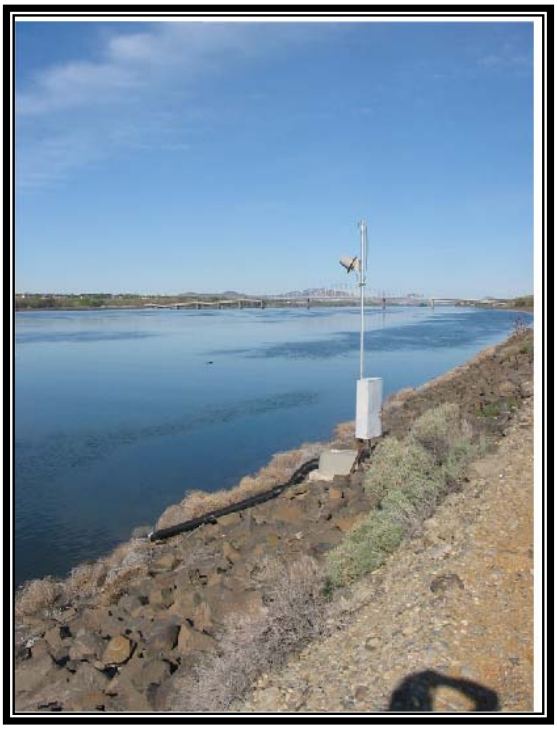

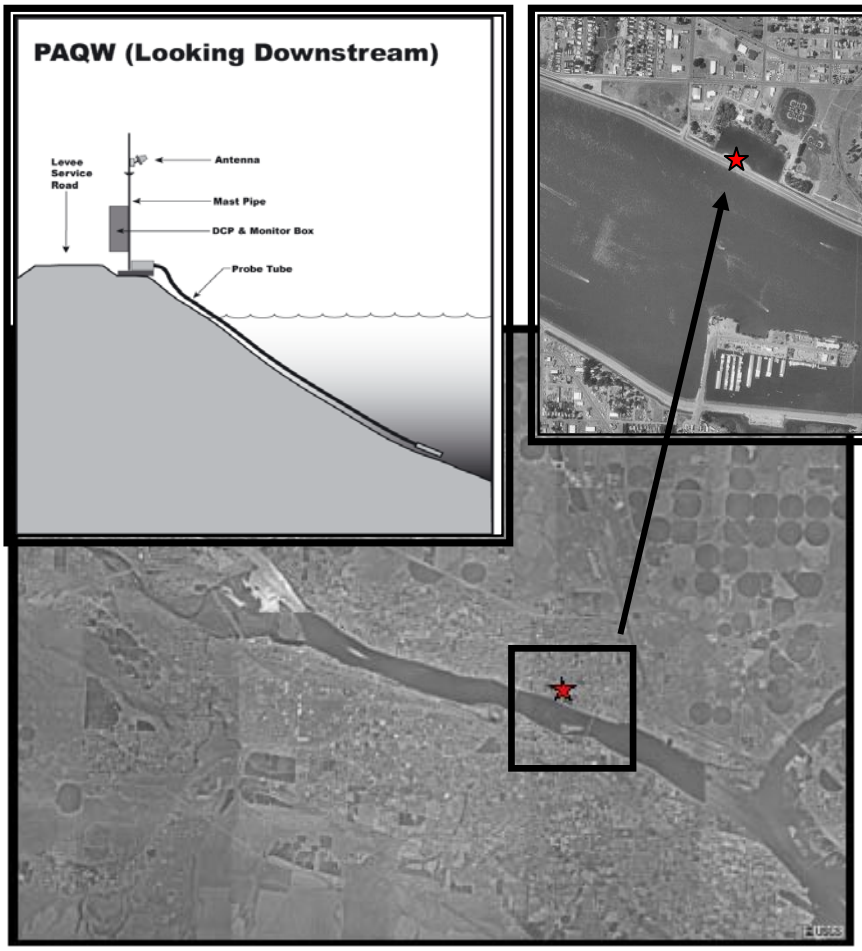

Peck TDG Monitoring Station (PEKI)

Gage Elevation: Fixed
Latitude: 46° 30' 0.9"
Longitude: 116° 23' 32.4"
Distance from Dam: --
Datum: NAD-83
River: Clearwater
River Mile: 37.4
USGS-ID: 13341050
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 15
Years of Operation: 1996-Present
Water Conditions: Open River
Location: On the southern shore of the Clearwater River approximately 3.5 miles downstream of the North Fork Clearwater River confluence.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

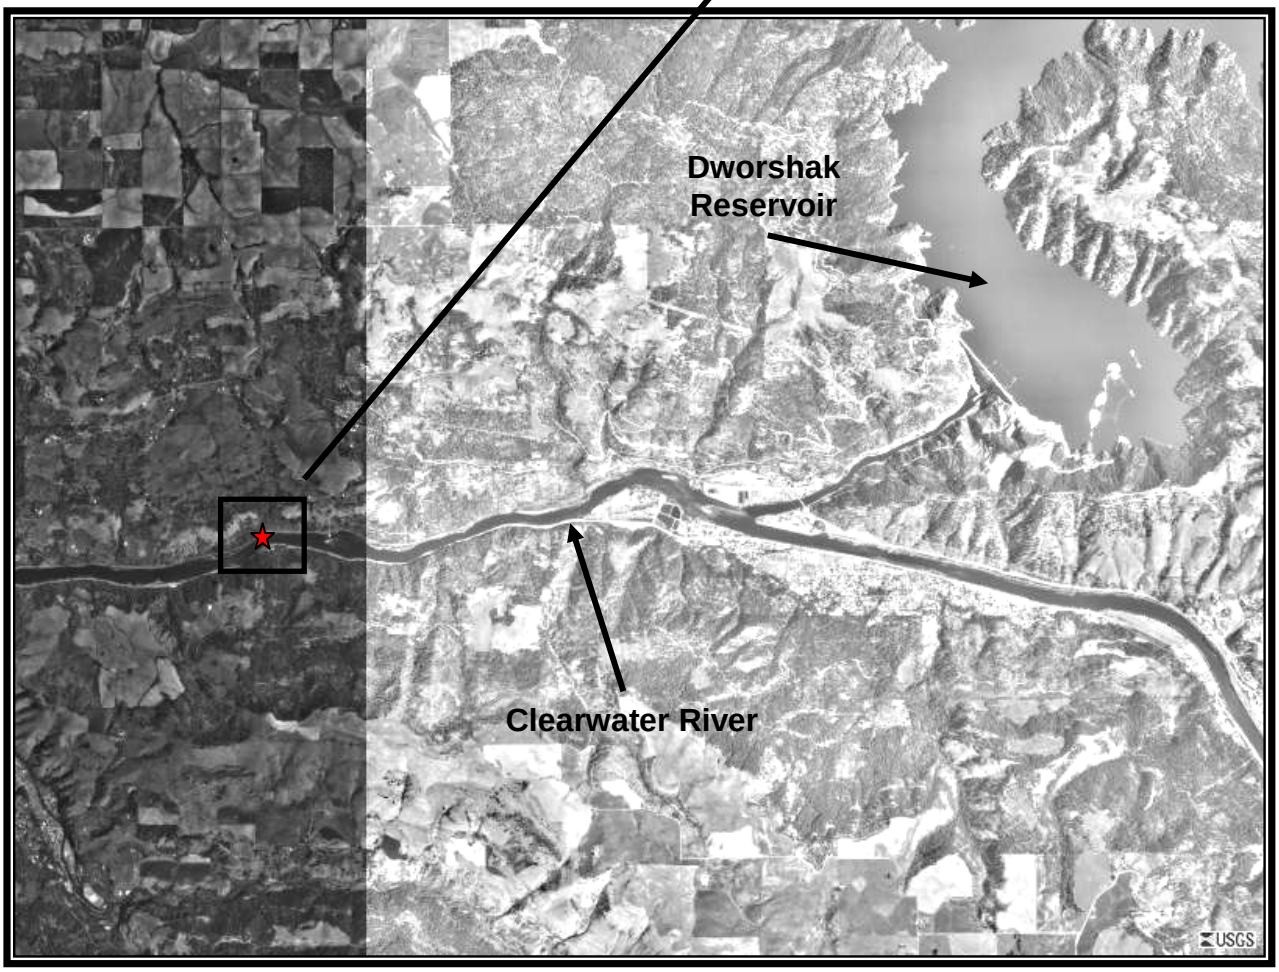

The Dalles Forebay TDG Monitoring Station (TDA)

Gage Elevation: Fixed
Latitude: 45° 37' 11.5" N
Longitude: 121° 07' 16.5" W
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 192.4
USGS-ID: 453712121071200
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: April 1 – Sept. 31
Years of Operation: 1985 - Present
Water Conditions: Mixed
Location: In forebay of dam near the end of Powerhouse Unit #22.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

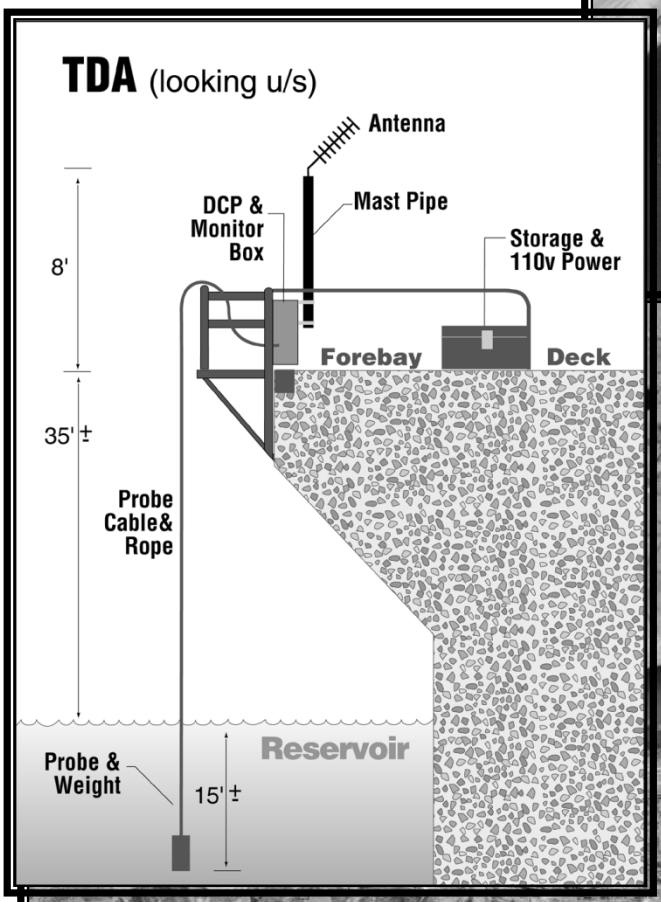

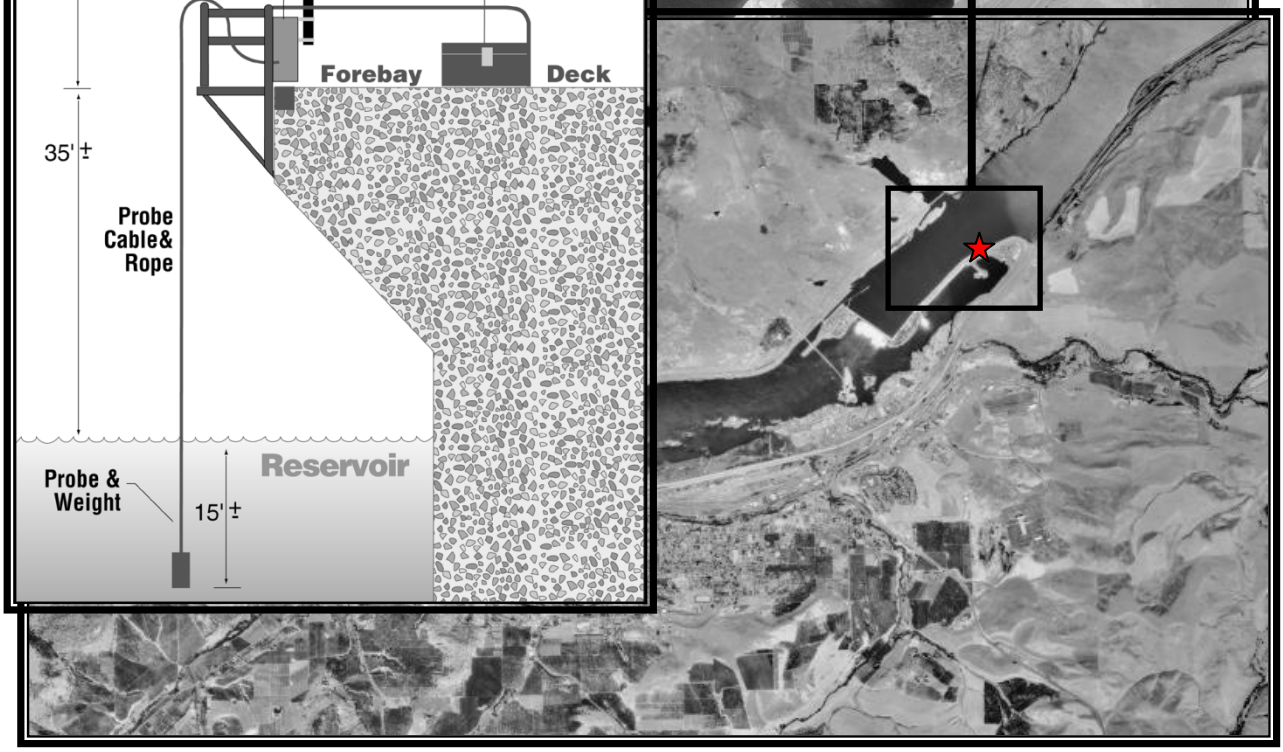

The Dalles Tailwater TDG Monitoring Station (TDDO)

Gage Elevation: Fixed (107.6 ft)
Latitude: 45° 36' 29.7" N
Longitude: 121° 11' 23.8" W
Distance from Dam: 2.5 miles
Datum: NAD-83
River: Columbia
River Mile: 189.1
USGS-ID: 14105700
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: Was seasonal prior to 2006, now year around
Years of Operation: 1996 - Present
Water Conditions: Mixed
Location: Off Bargeway Road from Webber Street, near industrial complex.
This gage replaced: N/A
Reason for replacement: N/A
Comments: --

Warrendale TDG Monitoring Station (WRNO)

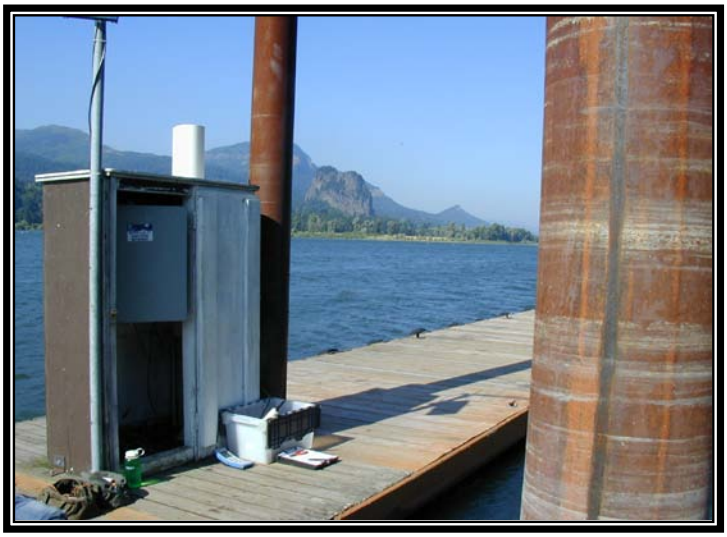
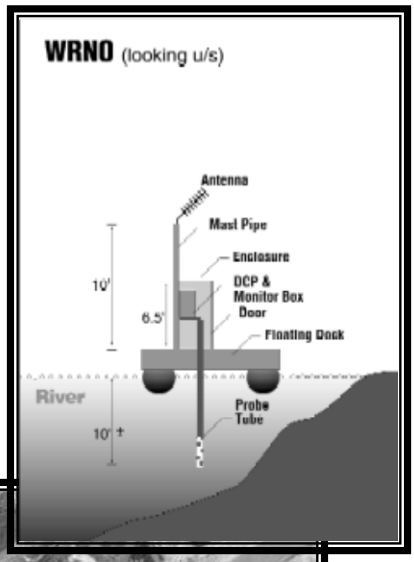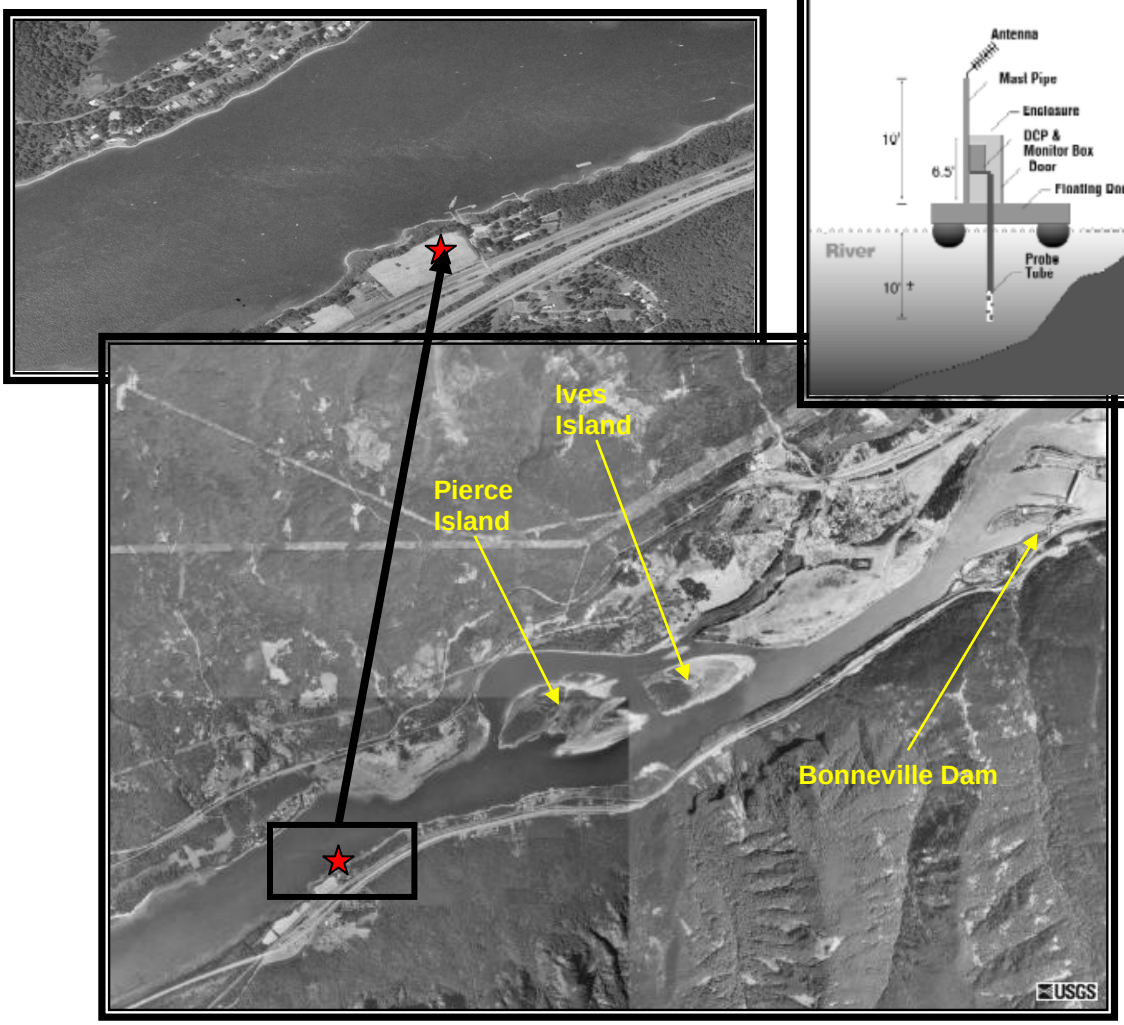
Gage Elevation: Variable
Latitude: 45° 36' 29.1" N
Longitude: 122° 02' 19.4" W
Distance from Dam: --
Datum: NAD-83
River: Columbia
River Mile: 140.3
USGS-ID: 453630122021400
Owner: U.S. Army Corps of Engineers
Gauge Type: Hydrosonde
Data Transmission: GOES Satellite
Dates of Operation: 1 March – 15 May
Years of Operation: 1985 - Present
Water Conditions: Mixed River
Location: This gauge is fixed to the boat dock at "The Fishery" off NE Enquist Pl in Dodson, Oregon (Near Warrendale) approximately 6 miles downstream of Bonnefille Dam.
This gage replaced: N/A
Reason for replacement: N/A
Comment: Up until the 2004 spill season, this gauge was used as the BON tailwater gauge for spill management and was operated year around. Currently, this gauge is being used as a fall, winter, and spring TDG monitor for Chum spawning.